

CORNER RESTORATION


CORNER: W $\frac{1}{4}$ Sec: 25 TWP: 11S. RANGE: 26E.

ORIGINAL SURVEY BY: Aaron F. York

CONTRACT NUMBER: 371

CONTRACT DATE: Sept. 8, 1880

Subsequent resurvey by Robert D. Bagett
dated July, 1968. (Grant County Mos #117)

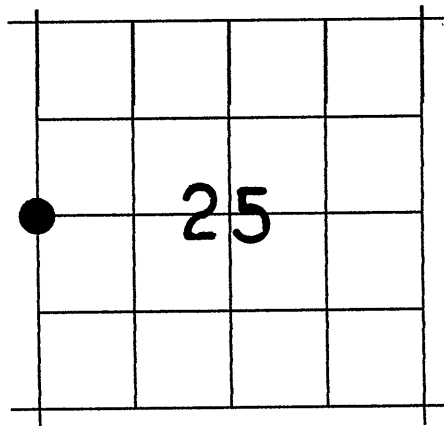

ORIGINAL DESCRIPTION: Set stone 12x10x8 for $\frac{1}{4}$ Sec. Cor. raised stone mound at Cor. From which: A house bears S80°E 4 chs. dist.

Bagett's Record: The W. $\frac{1}{4}$ cor. of sec. 25 monumented with a 1 inch iron pin driven flush with the ground and set in a low mound of stone on old fenceline.

I add mks. to the top of the iron pin to read:
From Which: New Bearing Trees:



A Pine 8"diam., bears N64°E, 118 lks. dist.,
mkd. 1/4 S25 BT.

A Pine 11"diam., bears N35°W, 100 $\frac{1}{2}$ lks. dist.,
mkd. 1/4 S26 BT.

S26 | $\frac{1}{4}$ S25
LS 598

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
S.D. Follweiler
G.J. Russell

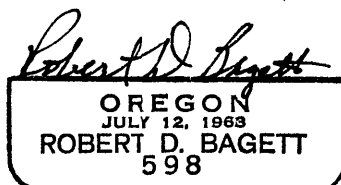

Oct. 30, 1992

RECEIVED AND
FILED

NOV 12 1992

OFFICE OF COUNTY SURVEYOR
Robert D. Bagett
Attest: *[Signature]*

Grant County Surveyor

EVIDENCE FOUND: Found a 1"x 33" iron rod set 23" in the ground,
From which:

A Pine 16"diam., bears N67°E, 76.8 ft.
with healed over blaze.

A Pine 27"diam., bears N29°W, 66.2 ft.
with healed over blaze.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

At the corner point: I set a 1 $\frac{1}{2}$ "x30" Galv. iron pipe,
30" in the ground, with attached Grant County Surveyor
Brass Cap marked as shown.

MONUMENT MARKED

ALSO I SET NEW REFERENCE POINTS:

A 5/8"x30" iron pin bears S45°E, 10.0 ft.
with attached aluminum cap marked RP 1 1992 OPLS 598.

A 5/8"x30" iron pin bears S45°W, 10.0 ft.
with attached aluminum cap marked RP 2 1992 OPLS 598.

GRANT COUNTY
SURVEYOR
T11S R26E
 $\frac{1}{4}$
S26 | S25
1992
OPLS 598

Buried 1" rod East and alongside iron pipe, raised a mound
of stone 3 ft. base to top of cap. Used mag. compass with 20°E var.
and a steel tape, measuring to a 50d nail driven in the sidecenter at the
rootcrown of the BT's. Painted BT blazes with red timber marking paint
and attached BT tags to BT's.

T-21