


RECORD OF LAND CORNER MONUMENTATION

CORNER: SW Cor. Sec. 27, Twp. 11 S., R. 26 E., W.M.

ORIGINAL SURVEY BY: Aaron F. York

CONTRACT NUMBER: 371

CONTRACT DATE: September 8, 1880

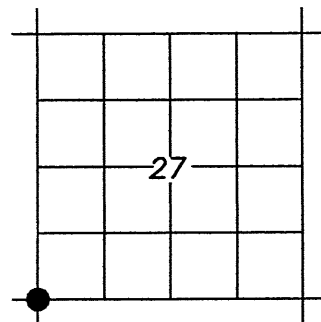

ORIGINAL G.L.O. DESCRIPTION: Set Stone 15x8x6 for Cor. to Secs. 27, 28, 33 and 34 Raised Stone Mound at Cor.

EVIDENCE FOUND: I searched for, but did not find the original marked stone. The search area falls on a steep eroded south facing hillside. After a diligent search, I determine this corner lost and set a new pin at proportionate measure between the following found corners: the SW Corner Sec. 28, The W1/4 Corner Sec. 34, the S1/4 Corner Sec. 27 and the NW Corner Sec. 27.

DESCRIPTION OF MONUMENT AND ACCESSORIES SET:

At the corner point, I set a 5/8"X30" iron pin with attached 2 1/2" aluminum cap, 27" in the ground. Built a 1 ft. mound of stone around the iron pin.


FROM WHICH, I SET THE FOLLOWING REFERENCE POINTS:

A 5/8"X30" iron pin bears N.82°49'E., 13.80 ft., with attached yellow plastic cap marked BENCHMARK SURVEYING

A 5/8"X30" iron pin bears S.38°11'E., 12.47 ft., with attached yellow plastic cap marked BENCHMARK SURVEYING

A 5/8"X30" iron pin bears S.70°57'W., 19.18 ft., with attached yellow plastic cap marked BENCHMARK SURVEYING

A 5/8"X30" iron pin bears N.54°03'W., 26.86 ft., with attached yellow plastic cap marked BENCHMARK SURVEYING

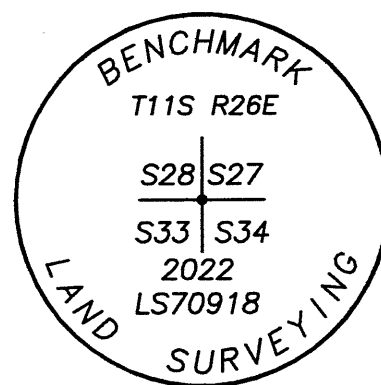

Used RTK GPS to measure to RP's. Bearings to RP's are based on Grant County Record Map of Survey No. 2190.

RESTORATION BY:


Michael C. Springer, PLS
David Dobson, Survey Tech.

Benchmark Land Surveying, Inc.
217 N. Canyon Blvd.
John Day, OR, 97845
(541) 575-1251
benchmarkls.com

Surveyed: August 30, 2022

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

SEP 1 2022

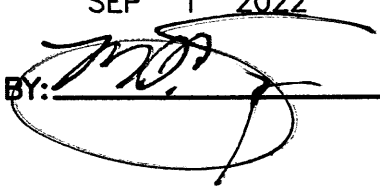BY: 

REGISTERED
PROFESSIONAL
LAND SURVEYOR


OREGON
JULY 9, 2022
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2024