


RECORD OF LAND CORNER MONUMENTATION

CORNER: W1/4 Cor. Sec. 34, Twp. 11 S., R. 26 E., W.M.

ORIGINAL SURVEY BY: Aaron F. York

CONTRACT NUMBER: 371

CONTRACT DATE: September 8, 1880

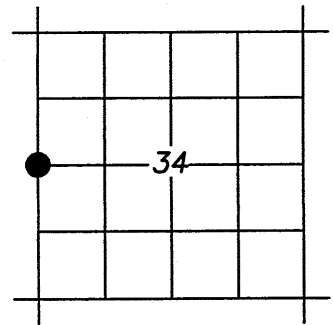

ORIGINAL G.L.O. DESCRIPTION: Set Stone 18X14X10 for 1/4 Sec. Cor. Raised Stone mound at Cor.

EVIDENCE FOUND: At the corner point we found a stone 18"X10"X7" marked 1/4. Stone was found in a 2 ft. mound of embedded stones.

DESCRIPTION OF MONUMENT AND ACCESSORIES SET:

At the location of the found stone, we set a 1½"X30" Galv. iron pipe with attached Grant County Surveyor Brass Cap, 22" in the ground. Cap is marked as shown below. We placed the marked stone face down, West and alongside the new monument in 3 ft. mound of stone.


FROM WHICH, I SET THE FOLLOWING REFERENCE POINTS:

A 5/8"X30" iron pin bears N.54°05'E., 28.67 ft., with attached aluminum cap marked GRANT COUNTY RP1

A 5/8"X30" iron pin bears S.40°27'E., 28.19 ft., with attached aluminum cap marked GRANT COUNTY RP2

A 5/8"X30" iron pin bears S.39°01'W., 30.01 ft., with attached aluminum cap marked GRANT COUNTY RP3

A 5/8"X30" iron pin bears N.40°56'W., 25.13 ft., with attached aluminum cap marked GRANT COUNTY RP4

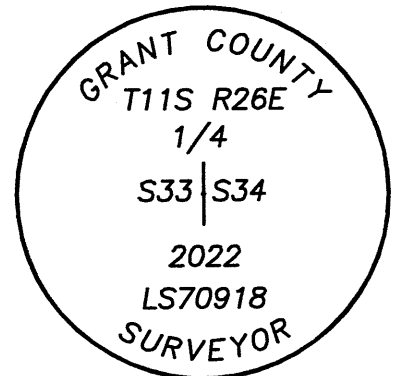

Used RTK GPS to measure Reference Points. Bearings to RP's are based on Grant County Record Map of Survey No. 2190.

RESTORATION BY:

Michael C. Springer, PLS
Grant County Surveyor
David Dobson, Survey Tech.

217 N. Canyon Blvd.
John Day, OR, 97845

Surveyed August 30, 2022

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

SEP 1 2022

BY:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2024