


CORNER RESTORATION

S 1/4 corner
CORNER Sec. 32 TWP 11 S RANGE 26 E

ORIGINAL SURVEY BY: W. Byars
CONTRACT NUMBER: 185
CONTRACT DATE: May 7, 1873

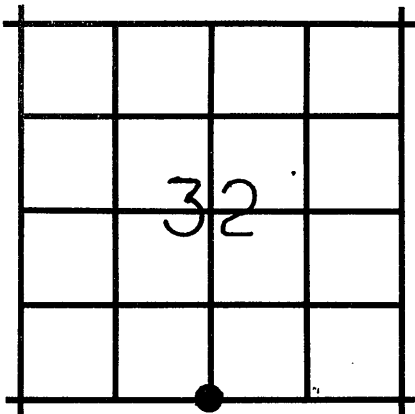

ORIGINAL DESCRIPTION:

South 89° 45' West on a true line between Secs. 5 and 32.
40.00 set 1/4 sec. cor. a stone 19x12x4.

RESTORATION BY, STAMP AND DATE:

D. I. Griffith
K. Leckenby

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Baggett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

April 30, 1979 Grant County Surveyor.

EVIDENCE FOUND:

Found stone of call size marked 1/4.

See Map of Survey No. 571.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

I accept the position of the corner stone.
At the corner point: Set a 1 1/2"x30" iron pipe in the ground with brass cap marked as shown. I buried the corner stone West and alongside the iron pipe and surrounded the pipe with a mound of stone, from which I scribe NEW BEARING TREES:
An 8" Juniper bears N. 24° W., 75.0 ft. mkd. 1/4S32CSBT.
A 5" Juniper bears S. 17° W., 58.2 ft. mkd. 1/4CSBT.
A fence corner with fence lines running North and East bears S. 45° W., 6.2 ft.

I used a magnetic compass with 20° East variation and steel tape, measuring to the center of the bearing trees.

MONUMENT MARKED

GRANT COUNTY SURVEYOR

T11S R26E

1/4 S 32

S 5

T 12S

1979

PLS 598

RECEIVED AND
FILED

AUG 31 1979

JOHN LIVEIRA, County Clerk
By *Janice Lauro* Deputy