

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established in 1881 by S.W. Lackland, Under General Land Office Contract No. 415. Surveyor Generals Notes State:
Set basalt stone 15x8x7" 12" in ground for $\frac{1}{4}$ section corner marked $\frac{1}{4}$ on W. face.

From Which:

A Pine 28" dia. bears S78°E, 158 lks dist. marked $\frac{1}{4}$ S BT.
Raised a mound of stone alongside.

DIAGRAM

T11S R30E
S3 $\frac{1}{2}$ S2
1983
PLS848

Description of corner evidence found:

Original stone not found.

Found 28" Pine down and dead, piece of rotten tree has scribing visible- $\frac{1}{4}$ S BT. Set corner position at record call where original BT stood.

Description of monument and accessories | established to perpetuate the original location of this corner:



Set a 36"x2" aluminum pipe iwth a 3 $\frac{1}{2}$ " aluminum cap stamped as shown in diagram.
Set 24" in the ground.

From Which:

A Juniper 20" dia. bears S63°E, 21.5 ft. scribed $\frac{1}{4}$ S2 BT.
A " 12" " " S15°W, 20.9 ft. " " S3 BT.

Nailed brass washers stamped PLS848, bearing tree & warning signs to each yree.
Painted 6" red band around each tree.

Set steel post with boundry & warning signs N&S 5 FT.

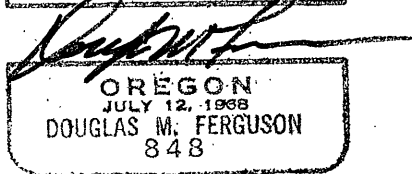

Corner monumented 5-26-83

Witnessed by Dan Martin

Office of.....Surveyor..... County of.....Grant.....

State of.....Oregon....., I hereby certify that the within instrument was filed in this office

for record on the 29th day of August, 1983.

Robert J. D. [Signature] by
(COUNTY OFFICIAL) (DEPUTY)