

RECEIVED A  
**FILE**  
 JUN 7 1971  
 JOHN LIVEIRA, County Clerk  
 By \_\_\_\_\_ Deputy


**CORNER RESTORATION**

CORNER 4,5,8,&9 TWP 11 S RANGE 35 E

ORIGINAL SURVEY BY: Robb & Gradon

CONTRACT NUMBER: 383

CONTRACT DATE: March 26, 1881

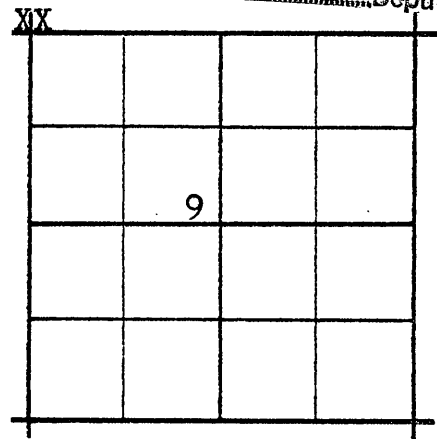

**ORIGINAL DESCRIPTION:**

Set basalt stone 12"x8"x7" for corner to sections 4, 5, 8 & 9  
 From which, a fir 12 ins. in dia. bears N 60°E, 7lks. dist.  
 A fir 8 ins. in dia. bears S 30°E, 12 lks. dist.  
 A pine 10 ins. in dia. bears S 50°W, 17 lks. dist.  
 A fir 12 ins. in dia. bears N 55° W, 12 lks. dist.

**RESTORATION BY, STAMP AND DATE:**

**BAGETT, GRIFFITH & FERGUSON**  
 170 S. DAYTON - PH. 575-1251  
 JOHN DAY, OREGON 97845

REGISTERED  
**OREGON**  
 LAND SURVEYOR  
*Douglas M. Ferguson*  
 JULY 12, 1968  
 DOUGLAS M. FERGUSON  
 848

May 23, 1971

**EVIDENCE FOUND:**

Found original stone with 4 grooves on the west face and 2 notches on the west edge.  
 from which we found rotten fir stump, 20 ins. dia. Bearing N 60°E 7 lks. dist., no marks visible.  
 A 18 ins. fir bearing S 30°E 12 lks. dist. with scribing visible.  
 A 12 ins. lodge pole pine, down and decaying, bearing S 50°W 17 lks. dist. marked T 11 S, R 35 E S8 BT

**DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:**

Show how trees are scribed and basis of bearings, including compass var.

Set 1½"x36" iron pipe 30" in the ground with brass cap marked as shown.  
 Placed original corner stone west and alongside iron pipe and raised a mound of stone around pipe.  
 Took new bearing trees as follows.  
 A white fir 8 ins. dia. bears S 37°W 17.4 ft. marked T11S R35E S8 BT  
 A tamarack 16 ins. dia. bears N 48°E 38.2 ft. marked T11S R35E S4 BT  
 A tamarack 8 ins. dia. bears N 57°W 16.8 ft marked Complete and File with Office of the Grant T11S R35E S5 BT  
 County Surveyor, Grant County, Oregon, Used compass var. 20°  
 Courthouse, Canyon City, Oregon 97820

**MONUMENT MARKED**

