


CORNER RESTORATION

CORNER W $\frac{1}{4}$ Sec. 18 TWP 11 S. RANGE 35 E.

ORIGINAL SURVEY BY: ROBB & GRADON

CONTRACT NUMBER: Joint Contract No. 383

CONTRACT DATE: March 26, 1881

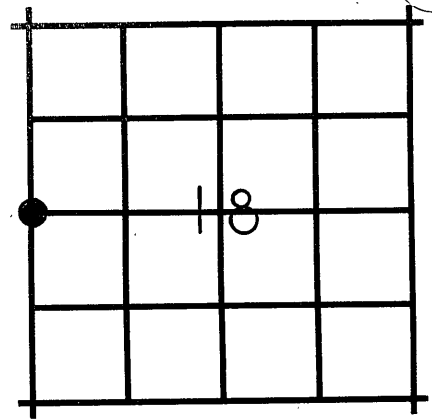

ORIGINAL DESCRIPTION: North on Range Line on West Boundary of Section 18.
 40.00 chs. set stone 16x8x6 inches for $\frac{1}{4}$ corner
 from which:
 A pine 6 inches in diam. bears N. 83° E. 50 lks.
 A pine 24 inches in diam. bears N. 65° W. 78 lks.

RESTORATION BY, STAMP AND DATE:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

R. D. Bagett
 J. L. Watson
 March 29, 1984

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

**RECEIVED AND
FILED**

APR 4 1984

OFFICE OF COUNTY SURVEYOR

Robert D. Bagett
 Attest: *Mary J. Moulton*

Grant County Surveyor

EVIDENCE FOUND: Found the original basalt corner stone marked $\frac{1}{4}$ on South face and set in a mound of stone, from which an original bearing tree bears N. 87 $\frac{1}{2}$ ° E., 33.0 ft., marked 4 S B in partially opened blaze. Meas. to face of blaze, I found no evidence of the BT in Sec. 13. It has probably been destroyed in logging operations.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: I set a 1 $\frac{1}{2}$ "x30" galvanized iron pipe 28 inches in the ground with brass cap marked as shown: From which:

The ORIGINAL BEARING TREE:


A pine 14 ins. diam. bears N. 87 $\frac{1}{2}$ ° E. 33.0 ft. mkd. 4 S B visible scribing in blaze that was opened years ago, scribing & blaze is fast deteriorating.

I scribe NEW BEARING TREES:

A pine 11 inches in diam. bears N. 47° E. 28.6 ft., mkd. T11SR35E $\frac{1}{4}$ S18CSBT.

A pine 12 inches in diam. bears N. 39° W. 26.8 ft., mkd. T11SR34E $\frac{1}{4}$ S13CSBT.

MONUMENT MARKED

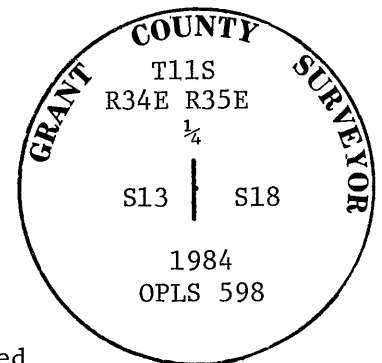

Buried corner stone West and alongside iron pipe and surrounded pipe with mound of stone to top of cap.
 Used magnetic compass with 20° E. variation and steel tape, measuring to head of a 40d nail driven flush with the BT blaze at root crown of tree.
 I attached County Surveyor BT tags to BTs and painted the scribing blazes on the new BTs with red timber marking paint.