


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner has not been previously set.

DIAGRAM

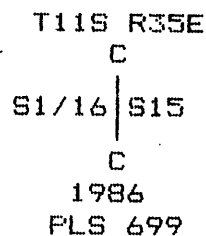

Description of corner evidence found:

Corner is being set by this survey.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 2"x30" aluminum pipe with a 3 1/4" aluminum cap, marked as shown in the diagram, 20" in the ground to rock, at a point as determined by the procedures set forth in the MANUAL OF INSTRUCTIONS FOR THE SURVEY OF PUBLIC LANDS for the subdivision of sections. The corner falls in a small creek, so a large rock mound 60" in diameter and 10" high was build around the monument to protect it from spring run-off., from which new BTs are:

13° Ponderosa pine bears N47° 30'E, 44.8 feet scribed CS1/16 S15 BT

13° Ponderosa pine bears S80° 45'E, 71.5 feet scribed CS1/16 S15 BT

Attached BT and Land Survey Monument signs to and painted a red band around each BT. Bearings were turned from the control traverse with a theodolite, basis of bearing being a solar observation, to stamped brass washers nailed in the scribed red-painted blazes. Distances were measured from a 60d spike, with an aluminum washer stamped PLS 699, which was driven into the side of each BT approximately one foot above the ground. Set steel fence posts out of the creek channel 16 feet W and 23 feet S of the corner on the National Forest property lines. Attached Forest Boundary signs to each post and a Land Survey Monument sign to the W post.

I, Leland L. Myers, P.O. Box 98, Sumpter, OR 97877, do hereby certify that on July 21, 1986, I established the corner as herein described.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Leland L. Myers

OREGON
JULY 9, 1985
LELAND LEE MYERS
699

FILED

IN THE OFFICE OF THE Grant COUNTY SURVEYOR
THIS 6 DAY OF April, 1987

Robert D. Bayett
Grant County Surveyor