


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

R-15

History of original corner establishment:

Original corner established in 1881 by Robb & Graden.

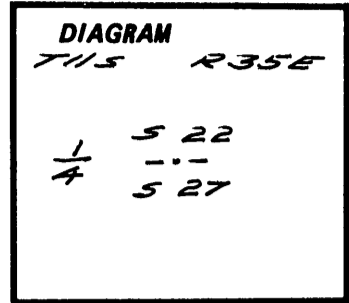

Set stone 14x12x5 from which:
 A 38" pine brs. N55°W 37 lks.
 A 12" pine brs. S50°W 61 lks.

MOS 1116

Description of corner evidence found: ~~stone~~ 15x10x5 stone, in stone mound, marked 1/4 on South face.

Dead & down pine snag with scribes. Root hole brs. S52°W 41.5.

Pine snag with scribes brs. N52°W 23.6'

Description of monument and accessories I established to perpetuate the original location of this corner: Set 2 1/4" x 30" aluminum pipe with 2 1/2" aluminum cap rising 8" in stone mound.

Cap marked

New BTs:
 A 9" PP brs. N43°E 28.7'
 marked 1/4 5 22 BT
 A 15" PP brs. S22°E 16.2'
 marked 1/4 5 27 BT

T115 R35E

1/4	5 22
4	5 27
	1989
	LS 1020

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

George W. Colvin, Jr.
 OREGON
 FEBRUARY 14, 1975
 GEORGE W. COLVIN, JR.
 1020

I hereby certify the above corner was perpetuated as described in July, 1989.

Office of County Surveyor County of Grant
 State of Oregon, I hereby certify that the within instrument was filed in this office for record on the 12 day of Dec, 1989
Robert H. Dwyer by _____
 (COUNTY OFFICIAL) (DEPUTY)