


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

X-13

History of original corner establishment:


Original corner established in 1881 by Robb & Graden.  
 Set stone 14x12x8 from which:  
 A 18" pine brs, 560°W 14 lns.  
 A 40" pine brs, 510°E 62 lns.

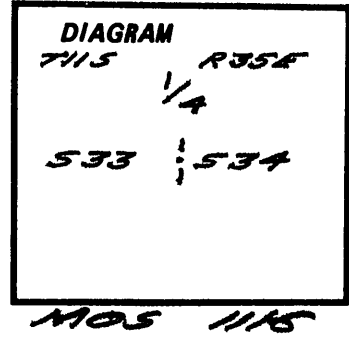

Description of corner evidence found: 14x13x8 stone with 1 marked on up face. Remainder of markings shattered away.

Dead & Down pine snag with BT brand in debris. Root hole brs, 557°W 11.1';  
 Low cut pine stump brs, 55°E 42.5'

Description of monument and accessories established to perpetuate the original location of this corner: Set 2 1/4" x 30" aluminum pipe with 2 1/2" aluminum cap rising 6" in stone mound. Buried original stone alongside.  
 New BTs:  
 A 8" PD brs, 538°E 29.2' marked 1/4 534 BT  
 A 8" PD brs, 549°W 22.5' marked 1/4 533 BT

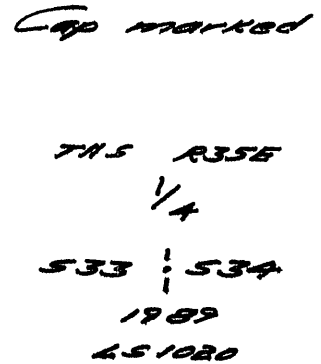

REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR

*George W. Colvin, Jr.*

OREGON  
 FEBRUARY 14, 1975  
 GEORGE W. COLVIN, JR.  
 1020

I hereby certify the above corner was perpetuated as described in Aug, 1989

Office of County Surveyor County of Grant  
 State of Oregon, I hereby certify that the within instrument was filed in this office for record on the 1 day of Dec, 1989  
Robert D. Dought by \_\_\_\_\_  
 (COUNTY OFFICIAL) (DEPUTY)

X-13