


CORNER RESTORATION

SE corner
CORNER Sec. 5 TWP 12 S RANGE 26 E

ORIGINAL SURVEY BY: Jason Owen

CONTRACT NUMBER: 194

CONTRACT DATE: July 1, 1873

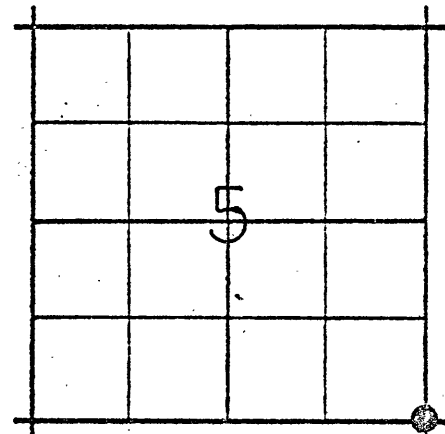

ORIGINAL DESCRIPTION:

North between Secs. 8 and 9.

80.00 set stone 12x12x8 for corner to Secs. 4, 5, 8 and 9.

RECEIVED AND
FILED

SEP 18 1979

JOHN LIVEIRA, County Clerk

Sammie Lawrence Deputy

RESTORATION BY, STAMP AND DATE:

D. I. Griffith
K. Leckenby
L. Mitchell
F. Jackson

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

April 25, 1979

Grant County Surveyor.

EVIDENCE FOUND:

Found stone 12"x10"x8" marked and set in small mound of stone.

See Map of Survey No. 571.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

I accept the position of the corner stone.

STANDARD NATIONAL PARK SERVICE.

At the corner point: Set 2½"x30" aluminum pipe with National Park Service aluminum cap marked as shown. I buried the corner stone South and alongside the aluminum pipe and surrounded the pipe with a concrete collar and a mound of stone, from which I scribed NEW

MONUMENT MARKED

BEARING TREES:

An 8" Juniper bears N. 44° E., 43.5 ft. mkd. T12SR26ES4BT.

A 5" Juniper bears S. 42° E., 14.2 ft. mkd. XBT.

A 10" Juniper bears N. 73° W., 29.3 ft. mkd. T12SR26ES5BT.

I used a magnetic compass with 20° East variation and steel tape, measuring to the center of the bearing trees.

Complete and File with Office of the Grant County Surveyor, Grant County, Oregon, Courthouse, Canyon City, Oregon 97820

