


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Original corner established by: William H. Byars, Deputy Surveyor,
under Contract No. 197, dated July 14, 1873.

Surveyor General Record States: Set stone 15x12x6 inches,
for quarter section corner.

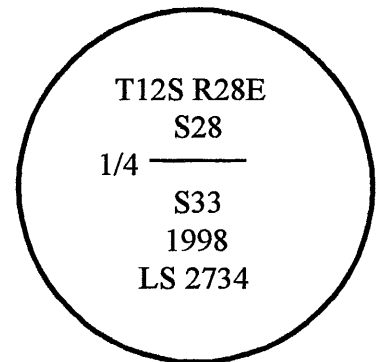

Description of corner evidence found:

No evidence of this corner was found. The corner falls in the remains
of an old fence.

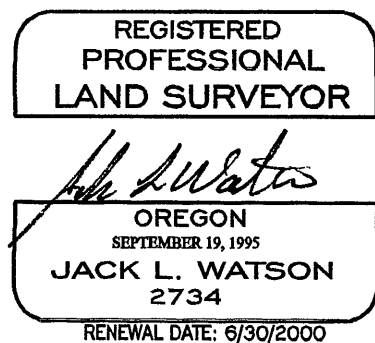

See Record Map of Survey No. 1485.

Description of monument and accessories set at corner location:

At the position determined by single proportionate measure, I set a 2½"x30" aluminum pipe with
attached 3" aluminum cap, 18 inches in the ground, surrounded by a mound of stone. The cap is
stamped as shown in the diagram.

From which I scribe new bearing trees:

A 10" Juniper bears N25°E, 87.19 feet, marked 1/4S28BT.

A 17" Juniper bears N86°E, 43.44 feet, marked 1/4S28BT.

A 9" Juniper bears S25°E, 100.99 feet, marked 1/4S33BT.

A 3" Juniper bears S54°W, 13.50 feet, marked XBT.

I used a steel tape measuring to a 50d nail driven in the side center at the root crown of the BT's
and magnetic compass, with 20° E. declination.

Date: July 6, 1998

Office of SURVEYOR County of GRANT
State of OREGON, I hereby certify that the within instrument was filed in this office
for record on the 15 day of JULY, 1998.
Robert D. Bennett by _____
(COUNTY OFFICIAL) (DEPUTY)