


CORNER RESTORATION

NE corner
CORNER Sec. 13 TWP 12 S., RANGE 30 E., W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

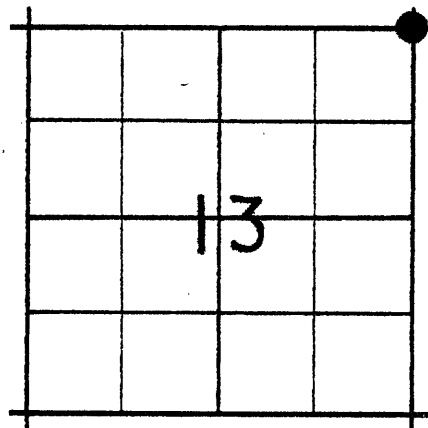

ORIGINAL DESCRIPTION:

80.00 Set stone 16x10x8 for corner to secs. 13, 13, 7, & 18.

RECEIVED AND
FILED

RESTORATION BY, STAMP AND DATE:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

AUG 28 1974
JOHN LIVEIRA, County Clerk

By _____ Deputy

August 20, 1974

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

Grant County Surveyor

EVIDENCE FOUND:

The original corner stone was not found. It has probably been destroyed by logging operations which have taken place in this area.

I establish this section corner at proportionate distance and on line between the found original $\frac{1}{4}$ corners $\frac{1}{2}$ mile south and $\frac{1}{2}$ mile north.

See Map of Survey No. 348.

This cor. is about 250 ft. West of U.S. Highway 395.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point described: Set a $1\frac{1}{2}$ " x 30" iron pipe 24" in the ground with brass cap marked as shown, from which I scribe MONUMENT MARKED

NEW BEARING TREES:

A 9" pine bears S.18°E., 4.0 ft., marked S18 CS BT.
A 6" pine bears S.42°W., 19.8 ft., marked S13 CS BT.
A 8" pine bears N57°W., 44.9 ft., marked S12 CS BT.
No new BT taken in NE quadrant.

I surrounded the pipe with a mound of stone.
Used compass with 20° East var. and steel tape, measuring to the face of the blaze on BTs.

Complete and File with Office of the Grant

County Surveyor, Grant County, Oregon,

Courthouse, Canyon City, Oregon 97820

