


CORNER RESTORATION

CORNER West $\frac{1}{4}$ Cor.
Sec. 13 TWP 12 S., RANGE 30 E., W.M.

ORIGINAL SURVEY BY: Samuel W. Lackland

CONTRACT NUMBER: 415

CONTRACT DATE: August 19, 1881

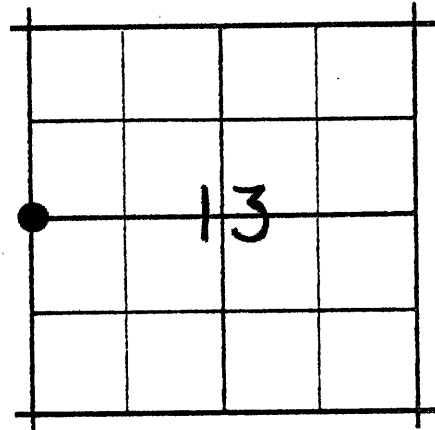

ORIGINAL DESCRIPTION:

40.00 Set Basalt Stone 14x9x8 ins. 10 ins. in the ground for $\frac{1}{4}$ sec. cor.
marked $\frac{1}{4}$ on West face from which
A pine 40 ins. diam., bears S.89°E., 10 lks. dist. marked $\frac{1}{4}$ S BT.
A pine 38 ins. diam., bears N.86°W., 41 lks. dist. marked $\frac{1}{4}$ S BT.

RESTORATION BY, STAMP AND DATE.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Baggett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

August 20, 1974

Grant County Surveyor

RECEIVED AND
FILED

AUG 28 1974

John Liveira
JOHN LIVEIRA, County Clerk

By _____ Deputy

EVIDENCE FOUND:

Found original corner stone, a basalt stone 12"x8"x5" marked $\frac{1}{4}$ and firmly nestled in a mound of stone, from which
ORIGINAL BEARING TREES:

A 50" P.Pine snag bears S.80°E., 7.8 feet, marked $\frac{1}{4}$ in partially healed blaze.
A 40" P.Pine snag, (20 ft. high) Bears S.77°W., 26.4 ft., marked $\frac{1}{4}$ S Bt in partially healed blaze.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set a 1 $\frac{1}{2}$ "x30" iron pipe 24 " in the ground with brass cap marked as shown, from which I scribe

MONUMENT MARKED

NEW BEARING TREES:

A 13" fir bears N37°E., 21.7 ft., marked $\frac{1}{4}$ S13 CS BT.
A 12" pine bears S88°W, 50.2 ft., marked $\frac{1}{4}$ S14 CS BT.

I buried the original cor. stone North and alongside the iron pipe and surrounded pipe with mound of stone. I used compass and steel tape. 20° East variation. Measured to face of blaze on BTs.

Complete and File with Office of the Grant
County Surveyor, Grant County, Oregon,
Courthouse, Canyon City, Oregon 97820

(See Map of Survey
No. 348).

