


CORNER RESTORATION

East $\frac{1}{4}$ corner
CORNER Sec. 13 TWP 12 S., RANGE 30 E., W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

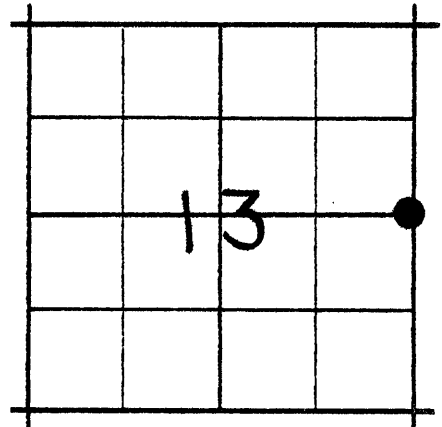

ORIGINAL DESCRIPTION:

40.00 Set stone 15x12x10 for $\frac{1}{4}$ sec. cor.

RESTORATION BY, STAMP AND DATE.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Baggett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

August 20, 1974

Grant County Surveyor

RECEIVED AND
FILED

AUG 28 1974

John Liveira
JOHN LIVEIRA, County Clerk

By _____ Deputy

EVIDENCE FOUND:

Found original corner, a basalt stone 16x9x10 inches set firmly in the ground and marked $\frac{1}{4}$. The position of this corner is in harmony with other known corners of the area as determined by Survey No. 348.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set a $1\frac{1}{2}$ "x30" iron pipe 22" in the ground with brass marked as shown: from which MONUMENT MARKED

NEW BEARING TREES:

A 9" pine bears S69°E., 16.7 ft., marked $\frac{1}{4}$ S18 CS BT.
A 9" pine bears S.3°W., 56.3 ft., marked $\frac{1}{4}$ S13 CS BT.

I buried the original cor. stone SE & alongside the iron pipe and surrounded the pipe with a mound of stone to the top of the pipe.

Used compass with 20° E. variation and steel tape, measuring to face of blaze of BTs.

Complete and File with Office of the Grant

County Surveyor, Grant County, Oregon,
Courthouse, Canyon City, Oregon 97820

Tagged BTs with C.S.
metal BT tags.

