


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner not previously established

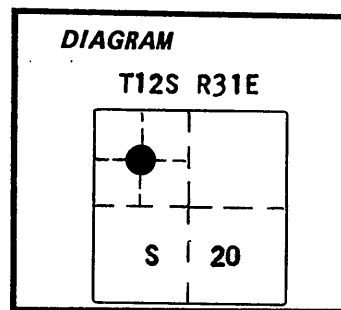

Description of corner evidence found:

NONE

See map of survey dated January 1985

Description of monument and accessories I established to perpetuate the original location of this corner: At the corner position, I set a 2½ inch x 30 inch aluminum pipe with aluminum cap marked as shown, 8 inches in the ground to bedrock, from which:

New BTs

A 12 inch diameter P.Pine bears N12°W 46.1 feet marked X BT

A 13 inch diameter P.Pine bears N75°W 82.6 feet marked NW1/16 S20 BT


NOTE: Corner position falls on top of a bank near a deep road cut. It was impractical to cross this cut to go to a bearing tree. I therefore am forced to take the bearing trees in the same quadrant.

Raised mound of stone around monument, 3 feet at the base narrowing to the top of the cap.

Set steel fenceposts approximately 5 feet East with 54-2 sign and approximately 5 feet South with 54-2 and 54-9 signs

Corner set September 18, 1984

Witnesses: Greg Blackman and Jeff Meyerholz

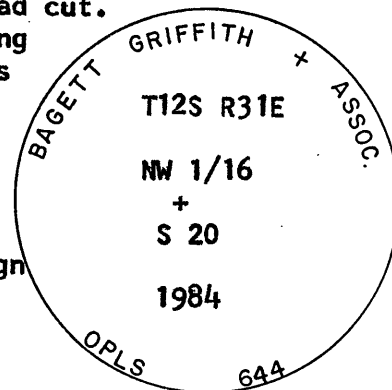

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 10, 1964

DUANE I. GRIFFITH
644

I used a steel tape and magnetic compass in the establishment of these accessories. I used 20° East magnetic declination and the distance to the BTs are to the center of the tree. I set a brass washer marked OPLS 644 at the BT blaze. I painted a 6 inch red band around all BTs and attached 54-3 and 54-9 signs.

Office of.....*Surveyor*..... County of.....*Grant*.....
State of.....*Oregon*..... I hereby certify that the within instrument was filed in this office
for record on the.....*11* day of.....*Feb*....., 19*85*.....
.....*Robert D. Baggett*..... by
(COUNTY OFFICIAL) (DEPUTY)