


CORNER RESTORATION

CW 1/16 COR.
CORNER Sec.19 TWP 12 S. RANGE 31 E.

ORIGINAL SURVEY BY:

CONTRACT NUMBER:



CONTRACT DATE:

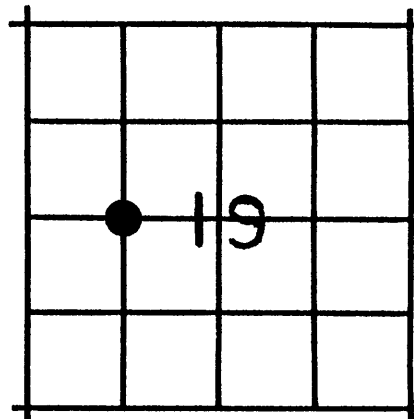

ORIGINAL DESCRIPTION: No previous monument established of record.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
J.L. Watson
G.J. Russell

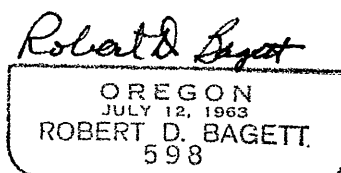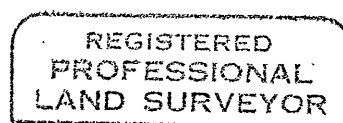

Aug.13, 1991

EVIDENCE FOUND: None

RECEIVED AND
FILED

AUG 28 1991

CLERK OF COUNTY SURVEYOR
Attest: *[Signature]*

See Record Map of Survey No. 1182.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.


At the corner point: I set a $2\frac{1}{2}$ "x30" Aluminum pipe, 30" in the ground, with attached Aluminum Cap marked as shown.

From which I SCRIBE NEW BEARING TREES:

A Juniper 10"diam., bears S29°E, 36.5 ft. marked CW1/16S19BT.

A Juniper 9"diam., bears S35°W, 22.4 ft. marked CW1/16S19BT.

MONUMENT MARKED

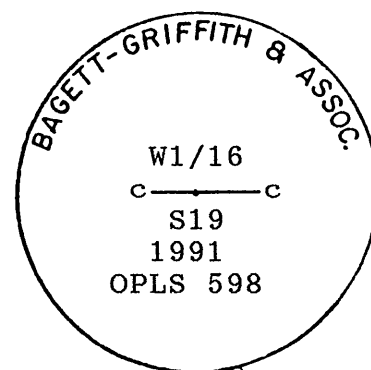

Raised a mound of stone 2 ft. base to top of cap. Used mag. compass with 20°E var. and a steel tape, measuring to a 50d nail driven in the sidecenter at the root crown of the BT's. Attached BGA BT tags.