


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by John B. David under GLO contract number 131 dated June 8, 1869. Surveyor General record states:

Set stone 16x8x8 for $\frac{1}{4}$ Sec. corner

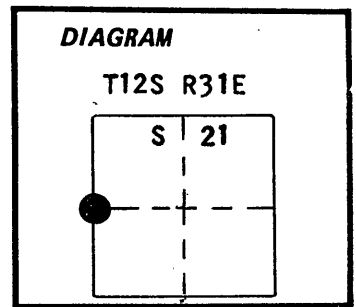

No record of subsequent remonumentation was found in the Grant County records

Description of corner evidence found:

NONE

Corner position falls in a field which has been farmed

Creek position has been disturbed by the placement of riprap, however the creek is quite relative to the original GLO call from this proportionate position

See map of survey dated January, 1985

Description of monument and accessories I established to perpetuate the original location of this corner: At proportionate distance, I set a $2\frac{1}{2}$ inch x 30 inch aluminum pipe with aluminum cap marked as shown, 27 inches in the ground, from which:




New BTs

A 24 inch diameter P.Pine bears N34°E 130.4 feet marked $\frac{1}{4}$ S21 BT
A 15 inch diameter P.Pine bears N9°W 157.0 feet marked $\frac{1}{4}$ S20 BT

Raised mound of stone around monument

Set steel fenceposts approximately 5 feet West with 54-2 sign and approximately 5 feet North with 54-2 and 54-4 signs

Corner set August 22, 1984
Witness: Mike Wagner

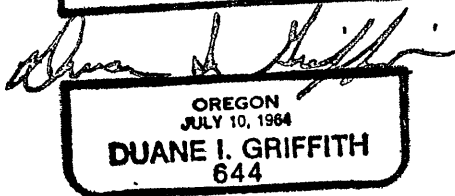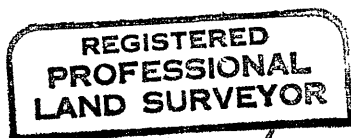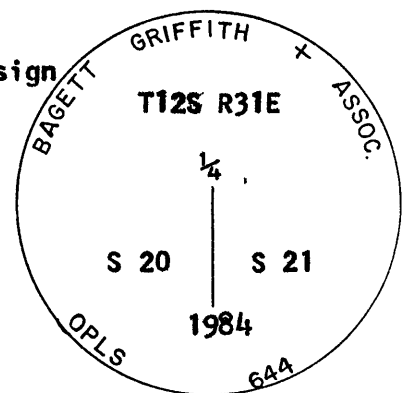

I used a steel tape and magnetic compass in the establishment of these accessories. I used 20° East magnetic declination and the distance to the BTs are to the center of the tree. I set a brass washer marked OPLS 644 at the BT blaze. I painted a 6 inch red band around all Bls and attached 54-3 and 54-4 signs.

Witness of *Surveyor* County of *Grant*
State of *Oregon*, I hereby certify that the within instrument was filed in this office
on *Sept 5* day of *1985*
by *Mike Wagner* (DEPUTY)
(COUNTY OFFICIAL)