


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Original corner established by: John B. David, Deputy Surveyor, under Contract No.131, dated June 8, 1869.

Record States: North 40.00 chs, Set stone 16x12x9 for 1/4 section corner.

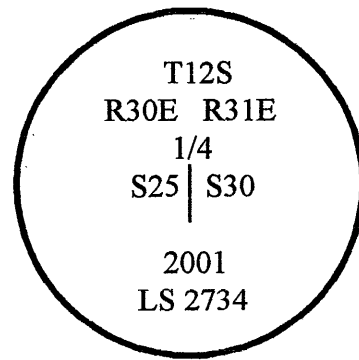

Description of corner evidence found:

No evidence of the original corner was found.

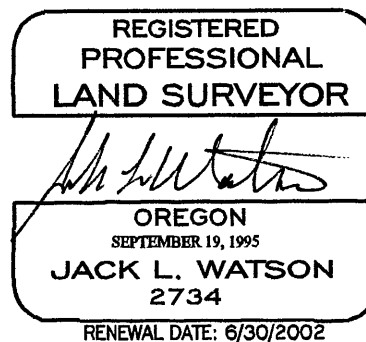

See Record Map of Survey No. 1623

Description of monument and accessories set at corner location:

At single proportionate position I set a 2 1/2"x30" aluminum pipe with attached 3" aluminum cap, 14 inches in the ground, surrounded by a mound of stone. The cap is stamped as shown in the diagram.

From which I scribe a new bearing trees:

- A 7" Juniper bears N38°E, 50.2 feet, marked 1/4S30BT.
- A 8" Juniper bears N74°E, 81.1 feet, marked 1/4S30BT.
- A 19" Juniper bears S68°E, 50.5 feet, marked 1/4S30BT.
- A 20" Juniper bears S40°W, 112.2 feet, marked 1/4S25BT.

I used a steel tape measuring to a 50d nail driven in the side center at the root crown of the BT's and magnetic compass, with 18° E. declination.

Date: July 16, 2001

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 25 day of JAN, 2002.
Robert D. Baggett by _____
(COUNTY OFFICIAL) (DEPUTY)