


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T.12S., R.31E., INDEX Z-7

History of original corner establishment:

This corner was originally established by John B. David under G.L.O. contract No. 131, dated June 8, 1869. Survey General notes state:

Set stone 17x7x5 for 1/4 sec. corner.

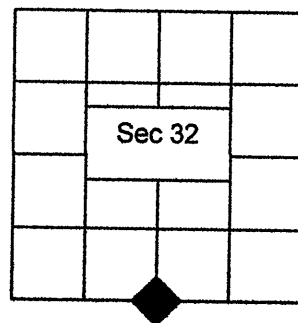

Description of corner evidence found:

No evidence of this corner is found. This corner has been previously searched for. See Map of Survey 785. Set monument based on the calculated position as shown on said Map of Survey 785.

Description of monument and accessories I establish to perpetuate the original location of this corner:

At the position determined by survey(see above), Map of Survey No. 1697, Set a 2-1/2" x 30" aluminum pipe monument w/3" dia. cap stamped as shown in the DIAGRAM, 20" in the ground, raised a 1' high x 3' dia. mound of earth and stone, from which:

- A 16" dia. Juniper bears N56°19'W, 82.9 ft., scribed 1/4 S32 BT.
- A 6" dia. Juniper bears N68°59'E, 107.5 ft., scribed X BT.
- A 8" dia. Juniper bears S07°51'E, 21.0 ft., scribed 1/4 S5 BT.
- A 20" dia. Juniper bears S36°42'W, 53.4 ft., scribed 1/4 S5 BT.

Painted red bands around BT's and painted blaze faces.
Attached a Brass washer stamped "PLS 49865" to the blaze face of the new BT's.

DIAGRAM

T11S R28E
S32
1/4 ----
S5
2003
PLS 49865

Measurements to accessories taken with Lieca TC 1600 Total Station.

I hereby certify that the above corner point was perpetuated as shown hereon on December 21, 2003

Witness: D. Mitchell Ferguson, LSIT
David H. Herburger, Surv. Tech.

Office of County Surveyor _____ County of Grant
State of Oregon . I hereby certify that the within instrument was filed in this office
for record on the 17 day of MAY, 2004

Robert D. Buzza by _____
County Surveyor Deputy

See Grant County Map of Survey No. 1697



RENEWAL DATE:
01/01/2006