


History of original corner establishment:
Corner not set in original survey.

I established this $\frac{1}{4}$ corner at the intersection of lines from opposite corresponding $\frac{1}{4}$ corners of this section.

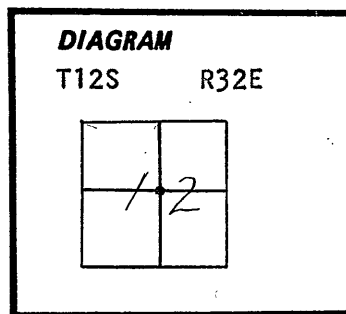

No record of subsequent monumentation found in County records.
Description of corner evidence found:

None

See map of survey dated September, 1980.

Description of monument and accessories I established to perpetuate the original location of this corner:


At intersection I set $2\frac{1}{2}$ " x 30" aluminum monument marked as shown 20" in ground from which;

NEW BTs

A 10" juniper bears S 11° E, 14.7 ft marked $C\frac{1}{4}$ S12 BT

A 26" p pine bears S 80° W, 26.9 ft marked $C\frac{1}{4}$ S12 BT

Raised mound of stone 3 ft base to top of monument

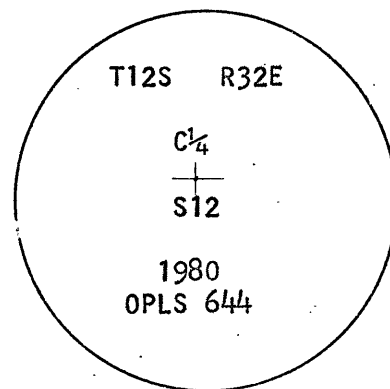

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 10, 1964
DUANE I. GRIFFITH
644

Brass washer nailed to BT blaze.
Used steel tape and magnetic compass
with 15° East declination.
Measured to center of new B.T.s

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 31 day of Oct, 1980
Robert D. Bagon by _____
(COUNTY OFFICIAL) (DEPUTY)