


History of original corner establishment:

Corner established in 1881 by Robb and Gradon under
General Land Office Contract No. 383.
Surveyor General Record states;

Set stone 16"x12"x8" for $\frac{1}{4}$ section corner from which;

A pine 10" diameter bears S 30° E, 15 links dist.

A pine 14" diameter bears N 60° W, 8 links dist.

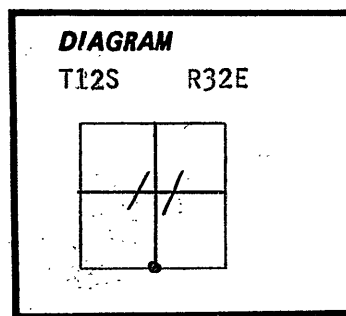

No record of subsequent remonumentation was found in county records.
Description of corner evidence found:

Found stone 13" x 10" x 7" marked $\frac{1}{4}$ on N edge well set.

Found SW BT, loose on ground to SW

See map of survey dated September, 1980.
**Description of monument and accessories established to perpetuate the
original location of this corner:**

In place of stone I set 2 $\frac{1}{2}$ " x 30" aluminum monument marked as shown 27" in ground
from which;



NEW BTs

A 20" p pine bears S 16° W, 50.8 ft marked $\frac{1}{4}$ S14 BT

A 21" p pine bears N 48° W, 9.3 ft marked $\frac{1}{4}$ S11 BT

Buried stone south and alongside

Raised mound of stone .

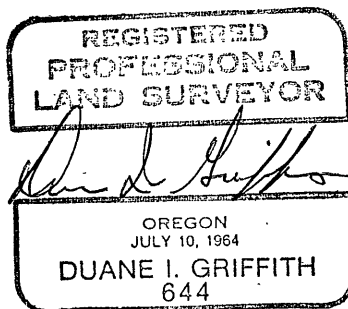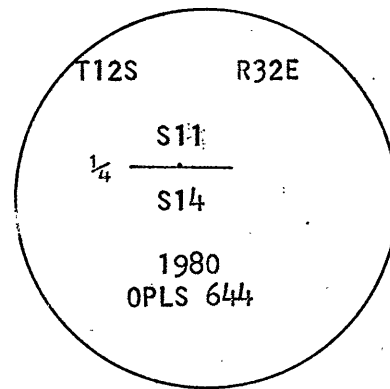

Brass washer nailed to BT blaze.
Used steel tape and magnetic compass
with 15° East declination.
Measured to center of new B.T.s

Office of..... *Surveyor* County of..... *Grant*
State of..... *Oregon* I hereby certify that the within instrument was filed in this office
for record on the... *31*... day of... *Oct* , 19... *80*
..... *Robert D. Baggett* by
(COUNTY OFFICIAL) (DEPUTY)