U.S. BUREAU OF LAND MANAGEMENT

History of original corner establishment:
Corner established in 1869 by John B. David under General Land Office Contract No. 131.
Surveyor General Record states;


Set stone 19" x 8" x 7" for corner to sections 12,13,7 and 18

Retracement by Robb & Gradon under Contract No. 383 dated, March 26, 1881. Page 92 of Government Field Notes states:

80.00 To corner to sections 12,13,7 and 18. It consisting of but a single stone about 19" x 8" x 7". I repair same by building stone mound and marking witness trees to which;

A fir 18" diameter bears N 35° W, 28 links dist.
A pine 24" diameter bears N 30° E, 43 links dist.
No record of subsequent remonumentation was found in County records.

DIAGRAM
T12S R33E

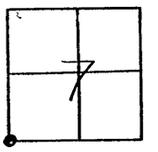

Description of corner evidence found:

Found stone of call size, no marks seen, in a mound of stone, and the 2 BTs.

See map of survey dated September, 1980.
Description of monument and accessories I established to perpetuate the original location of this corner:

In place of stone, I set 2½" x 30" aluminum monument marked as shown 20" in ground from which;

ORIGINAL BTs
A 36" fir bears N 34° W, 18.5 ft blaze evident, live vigorus


A 22" pine N 30° E, 28.4 ft, dead and down, scribes visible

NEW BTs
A 10" fir bears N 42° E, 61.5 ft marked T12S R33E S7 BT

A 18" p pine bears S 45°E 78.7 ft marked T12S R33E S18 BT

A 12" fir bears S 76° W, 20.0 ft marked T12S R32E S13BT

Buried stone morth and alongside
Raised mound of stone

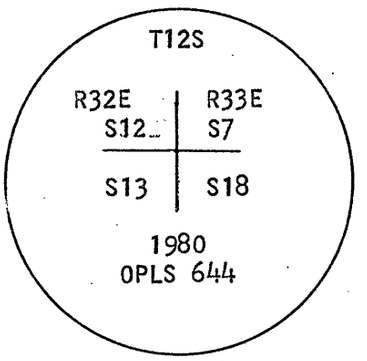

REGISTERED PROFESSIONAL LAND SURVEYOR
OREGON
JULY 10, 1964
DUANE I. GRIFFITH
644

Brass washer nailed to BT blaze.
Used steel tape and magnetic compass with 15° East declination.
Measured to center of new B.T.s

Office of Surveyor *County of* Grant
State of Oregon, *I hereby certify that the within instrument was filed in this office for record on the* 31 *day of* Oct, 19 80
Robert O Bagett *by* .....
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

☆GPO—798-276

8/5

J-25