

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Corner originally established by Robb and Gradon under GLO contract number 383 dated March 26, 1881.

Surveyor General record states:

Set stone 14x10x6 for $\frac{1}{4}$ sec. cor. from which;

A pine 14 in dia bears N16W 37 lks dist

A pine 12 in dia bears East 58 lks dist

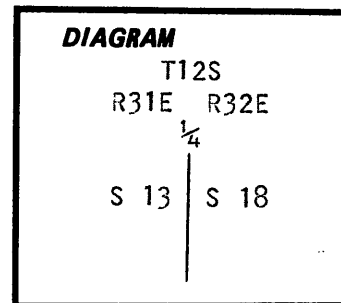

Description of corner evidence found:

Found a stone mound with stone of called size, firmly set, no marks visible

Found a 26 inch diameter P.Pine North 85° East, 38.3 feet dist, has been chopped open, tree is live and vigorous

Found a 24 inch diameter P.Pine North 16° West, 24.4 feet, has been opened with scribing visible, tree is live and vigorous

Description of monument and accessories I established to perpetuate the

original location of this corner: In place of stone, I set a $2\frac{1}{2}$ " x 30" aluminum pipe with aluminum cap marked as shown, 18 inches in the ground.

The above described trees are live and vigorous, I therefore take no new BTs

I buried the original stone South and alongside of the new monument

Raised mound of stone around new monument



Attached 54-4 signs, bearing tree tags to and painted a 6 inch red band around the existing bearing trees

Set a steel fence post approximately 5 feet South with 54-4 sign

Corner set October 20, 1983

Witness: Rick Robinson

See survey number 792

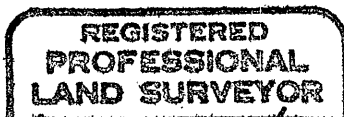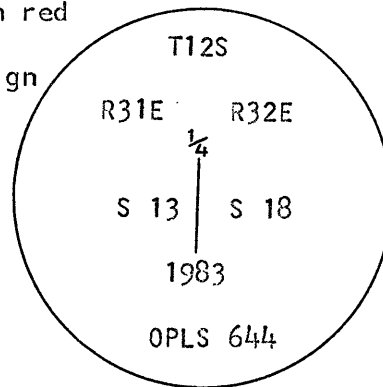

Duane I. Griffith



I used a steel tape and magnetic compass in the location of these accessories. I used $17\frac{1}{2}$ ° East magnetic declination, and the distances to the existing BTs are to the face of the blaze.

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 30 day of NOV, 1983
Robert D. Bayett by _____
(COUNTY OFFICIAL) (DEPUTY)