

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by John B. David, under GLO contract number 131, dated June 8, 1869.

Surveyor General record states:

Set stone 16x10x5 for $\frac{1}{4}$ Sec corner

DIAGRAM

T12S R32E
S 18
 $\frac{1}{4}$ —————
S 19

Description of corner evidence found:

NONE

This area has been extensively logged. I found the corner search area has been completely torn up by skidding and cat tracks.

Description of monument and accessories I established to perpetuate the

original location of this corner: At proportionate distance, I set a $2\frac{1}{2}$ " x 30" aluminum pipe with aluminum cap marked as shown 30 inches in the ground, from which:

New BTs

A 12 inch diameter tamarack bears North 31° East, 37.4 feet, marked $\frac{1}{4}$ S18 BT
A 16 inch diameter Red Fir bears South 77° West, 15.4 feet, marked $\frac{1}{4}$ S19 BT

Raised mound of stone around new monument

Set steel fence post approximately 5 feet West with 54-4 sign
Attached 54-4 signs and bearing tree tags to and painted a 6 inch red band around all bearing trees


Corner set October 21, 1983

Witnesses: Greg Blackman and Rick Robinson

See survey number 792

T12S R32E
S 18
 $\frac{1}{4}$ —————
S 19

1983
OPLS 644

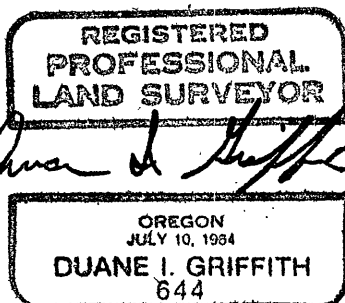

I used a steel tape and magnetic compass in the establishment of these accessories. I used $17\frac{1}{2}^{\circ}$ East magnetic declination, and the distances to the new BTs are to the center of the tree. I attached a brass washer marked OPLS 644 by the BT blaze of the new bearing trees.

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 30 day of NOV, 1983
Robert D. Baggett by _____
(COUNTY OFFICIAL) (DEPUTY)