


CORNER RESTORATION

South $\frac{1}{4}$ cor.
CORNER Sec. 35 TWP 12 S. RANGE 32 E., W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131



CONTRACT DATE: June 8, 1869

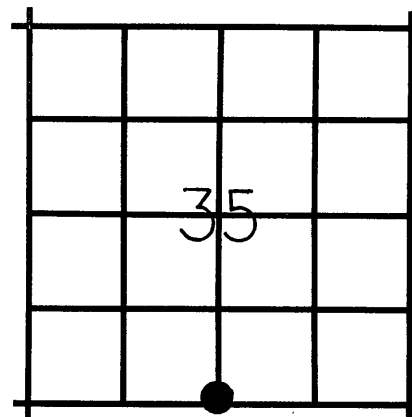

ORIGINAL DESCRIPTION: GLO Field notes of the third standard
parallel state: 40.00 chs: set stone 17x7x8 for
 $\frac{1}{4}$ sec. cor.

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
J. L. Watson
T. R. Steele

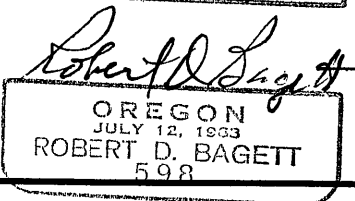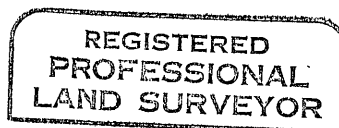

Sept. 27, 1985

Grant County Surveyor

EVIDENCE FOUND: Found original corner stone 14x11x7 inches marked
 $\frac{1}{4}$ and set in partial ring of stones. I accept the position of this stone
for the $\frac{1}{4}$ corner. It is harmoniously related to other known corners
along this township line.

RECEIVED AND
FILED

OCT 16 1985

OFFICE OF COUNTY SURVEYOR

Robert D. Bagett
Attest: *Dannine Laurance*

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

In place of the cor. stone I set a $1\frac{1}{2}$ "x30"
galvanized iron pipe 15 inches in the ground with
brass cap marked as shown:
From which I scribe NEW BEARING TREES:

- A juniper 12 ins. diam., bears N. 41° E., 47.1 ft.,
mkd., T12SR32E $\frac{1}{4}$ S35 CSBT.
- A juniper 9 ins. diam., bears S. 19° E., 54.1 ft.,
mkd., T13SR32E $\frac{1}{4}$ S2 CSBT.

Buried orig. cor. stone North and alongside pipe.
Surrounded pipe with mound of stone, 4 ft. base to top
of cap.

Used magnetic compass with 16° E. var. and steel tape.
Distance measured to 40d nail driven in side center of BT's
at root crown.

Painted BT blazes with red timber marking paint and attached
County Surveyor BT tags to bearing trees.

MONUMENT MARKED

