


CORNER RESTORATION

CORNER N.W. Corner
Sec. 16 TWP 12 S RANGE 35E., W.M.

ORIGINAL SURVEY BY: BAMFORD ROBB

CONTRACT NUMBER: 383

CONTRACT DATE: March 26, 1881.

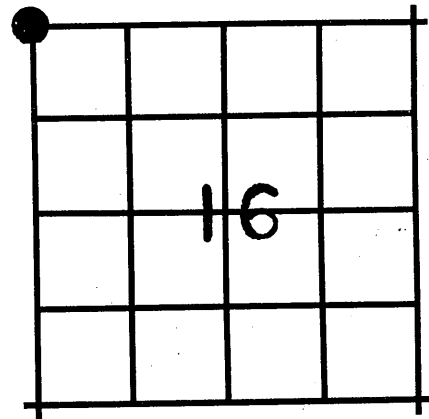

ORIGINAL DESCRIPTION:

North between Secs. 16 & 17:

80.00 set basalt stone, 16x9x5 in mound of stone for corners to Secs. 8, 9, 16 & 17, from which:

a Pine 20" in diam. bears S. 73° W. 23 lks. dist.
A Pine 36" in diam. bears S. 85° E. 10 lks. dist.

RECEIVED AND
FILED

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
F. Jackson
K. Leckenby

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

JUL 2 1979
John Liveira
JOHN LIVEIRA, County Clerk
By _____ Deputy

May 30, 1979

Grant County Surveyor.

EVIDENCE FOUND:

Found the original corner stone a 18"x12"x7" marked basalt stone, from which:

ORIGINAL BEARING TREES:

A pine stump up-rooted bears S. 82° E., 8.0 ft. mkd. BT- has been moved.

See Map of Survey No. 570.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED: Show how trees are scribed and basis of bearings, including compass var.

I accept the position of the corner stone.

MONUMENT MARKED

At the corner point: set 1½"x30" iron pipe 23" in the ground with brass cap marked as shown, from which I scribe

NEW BEARING TREES:

A 13" fir bears N. 5° E., 20.5 ft. mkd. T12SR35ES9CSBT
An 11" larch bears S. 74° E., 19.4 ft. mkd. T12SR35ES16CSBT
A 29" pine bears S. 74° W., 25.3 ft. mkd. T12SR35ES17CSBT
A 16" fir bears N. 58° W., 26.9 ft. mkd. T12SR35ES8CSBT.
I buried the original corner stone East and alongside the iron pipe and surrounded the pipe with a mound of stone.
I used a compass with 20° variation and steel tape, measuring to the center of the bearing trees.

