


CORNER RESTORATION

N. E. Corner
CORNER Sec. 16 TWP 12 S RANGE 35 E., W.M.

ORIGINAL SURVEY BY: BAMFORD ROBB

CONTRACT NUMBER: 383

CONTRACT DATE: March 26, 1881

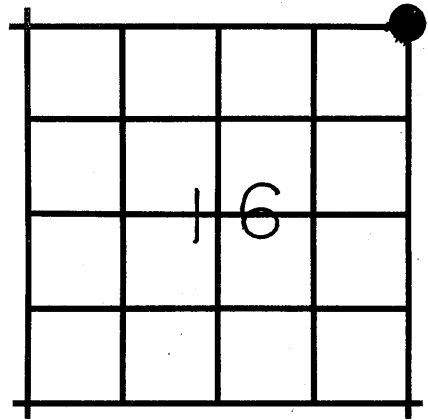

ORIGINAL DESCRIPTION:

North between Secs. 15 and 16:

80.00 set basalt stone 20x12x12 in mound of stone for corner to Secs. 9, 10, 15 & 16, from which:



A fir 36" in diam. bears N. 50° W., 34 lks. dist.

A fir 24" in diam. bears N. 26° E., 19 lks. dist.

RECEIVED AND
FILED

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
R. Jackson
K. Leckenby

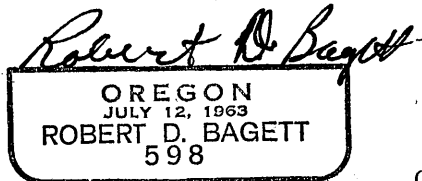

JUL 2 1979
John Liveira
JOHN LIVEIRA, County Clerk
By.....Deputy

May 30, 1979

Grant County Surveyor.

EVIDENCE FOUND:

Found the original corner stone a 17"x16"x6" basalt stone (broken) marked with 3 grooves and 4 notches set in mound of stone, from which:

ORIGINAL BEARING TREES:

A live 26" fir bears N. 55° E., 9.5 ft. with visible scribing.

A fir stump hole bears N. 50° W., 23.2 ft., no visible marks.

See Map of Survey No. 570.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

I accept the position of the corner stone.

MONUMENT MARKED

At the corner point: Set 1½"x30" iron pipe 24" in the ground with brass cap marked as shown, from which I scribe:

NEW BEARING TREES:

A 7" fir bears S. 37° E., 39.4 ft. mkd. T12SR35ES15CSBT

A 5" larch bears S. 86° W., 15.1 ft. mkd. T12SR35ES16CSBT

A 6" fir bears N. 45° W., 33.3 ft. mkd. T12SR35ES9CSBT.

I buried the original corner stone East and alongside the iron pipe and surrounded the pipe with a mound of stone. I used a compass with 20° East variation and steel tape, measuring to the center of the bearing trees.

