


# CORNER RESTORATION

S. E. Corner  
CORNER Sec. 16 TWP 12 S. RANGE 35 E., W.M.

ORIGINAL SURVEY BY: BAMFORD ROBB

CONTRACT NUMBER: 383

CONTRACT DATE: March 26, 1881

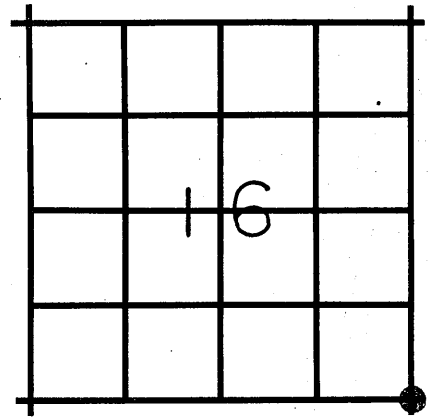

## ORIGINAL DESCRIPTION:

North between Secs. 21 & 22:

80.00 set basalt stone, 16x12x7 in mound of stone for corner to Secs. 15, 16, 21 and 22, from which:



A fir 12" in diam. bears S. 82° E. 18 lks. dist.

A tamarack 8" in diam. bears S. 70° W. 21 lks. dist.

RECEIVED AND  
FILED

## RESTORATION BY, STAMP AND DATE:

R. D. Bagett  
R. Jackson  
K. Leckenby

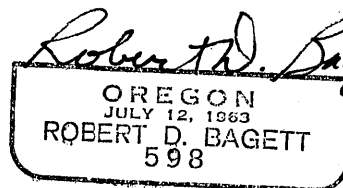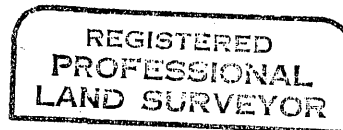

JUL 2 1979  
*John Liveira*  
JOHN LIVEIRA, County Clerk  
By ..... Deputy

May 30, 1979

Grant County Surveyor.

## EVIDENCE FOUND:

Found the Original corner stone a 15"x11"x7" basalt stone marked with 3 notches and 3 grooves firmly set in a mound of stone, from which:

## ORIGINAL BEARING TREES

A 26" fir bears S. 77° E., 11.9 ft, with scribing blaze healed over. I did not open.  
A 22" tamarack bears S. 56° W., 16.7 ft. with scribing blaze healed over. I did not open.

See Map of Survey 570.

## DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

I accept the position of the corner stone.

At the corner point: Set 1½"x30" iron pipe 24" in ground with brass cap marked as shown, from which I scribe

## NEW BEARING TREES:

A 10" larch bears N. 45° E., 41.2 ft. mkd. T12SR35ES15CSBT

A 10" larch bears N. 28° W., 59.9 ft. mkd. T12SR35ES16CSBT.

I buried the original corner stone south and alongside the iron pipe and surrounded the pipe with a mound of stone. I used a compass with 20° East variation and steel tape, measuring to the center of the bearing trees.

## MONUMENT MARKED

