CORNER RESTORATION

CORNER: E1/4 SEC. 36 TWP. 12 S. RANGE 26 E.

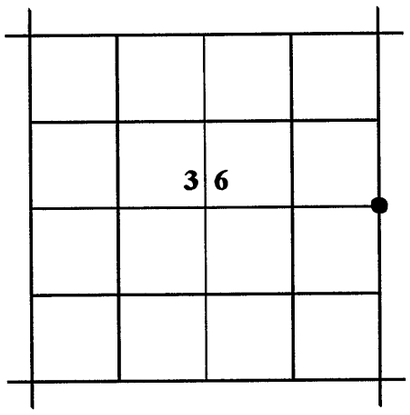

ORIGINAL SURVEY BY: William H. Byars, U.S. Deputy Surveyor

CONTRACT NUMBER: 185

DATE APPROVED: May 7, 1873

Subsequently remonumented by Vernon Glaze, Grant County Surveyor in 1914. See Survey No. 7G

ORIGINAL DESCRIPTION: Set 1/4 Sec cor. A stone 18x10x7
Record Map of Survey No. 7G states: "common cor Sec 36-31 set iron post with Brass cap marked and wooden post 4x4x4 scribed erected monument of stone..."

RESTORATION BY, STAMP AND DATE:

M.C. Springer, PLS
J.L. Hatfield, PLS

RECEIVED AND FILED

May 13, 2009
OFFICE OF COUNTY SURVEYOR

ATTEST:

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2010

May 5, 2009 Grant County Surveyor

EVIDENCE FOUND: Found Glaze's 1" iron pipe with attached 2" brass cap, marked as shown below and oriented correctly, set firmly in the ground surrounded with a mound of stone. I accept Glaze's brass cap monument as the position of the 1/4 section corner.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Glaze's brass capped iron pipe is firmly set and in good condition. I leave it at the corner point for the position of the 1/4 section corner.

From which I SET NEW REFERENCE POINTS:
A 5/8"x30" iron pin, bears N41°46'02"E, 38.19 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 1 2009.
A 5/8"x30" iron pin, bears S44°50'46"W, 43.85 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 2 2009.
A 5/8"x30" iron pin, bears S42°48'08"W, 39.55 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 3 2009.
A 5/8"x30" iron pin, bears N45°19'40"W, 39.36 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 4 2009.

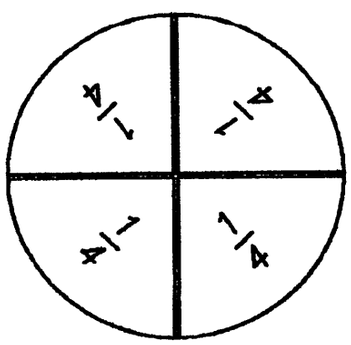

See Record Survey No. 1865 for Basis of Bearings.
Used RTK GPS to measure the RPs. I drove a steel fence post 1 foot east of the monument and attached a Grant County Surveyor BT tag.

STATE PLANE COORDINATES (3601 OR N) Reference Datum: NAD83
Northing = 299357.24 (US Survey feet)
Easting = 8454854.80 (US Survey feet)