

RECORD OF LAND CORNER MONUMENTATION


CORNER: E $\frac{1}{4}$ Cor. Sec. 5, Twp. 13S., R.27E., W.M.

ORIGINAL SURVEY BY: W. H. Byars

CONTRACT NUMBER: 197

CONTRACT DATE: May 1, 1873

SUBSEQUENT SURVEYS: Vernon L. Glaze 1914, Jack L. Watson 2005

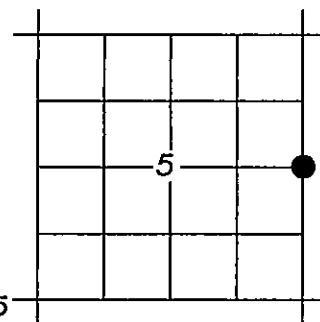

ORIGINAL G.L.O. DESCRIPTION: Set Basalt stone 24x10x5 for the Quarter Section Corner.

1914 RESURVEY BY GRANT COUNTY SURVEYOR VERNON GLAZE 1914:

Est $\frac{1}{4}$ common cor sec 5-4 Set iron post Brass cap marked and wood post 4x4x4.0 Scribed Set rock marked $\frac{1}{4}$ C.S. erected monument of stone.

2005 RESURVEY BY JACK L. WATSON, PLS, DATED 11/29/2005.

No Evidence of the original corner stone was found. The iron post set by Glaze was not found. No evidence of the stone or wooden post was found. See Record Map of Survey No. 1745. At the position determined by single proportion, I set a 2 $\frac{1}{2}$ "x30" aluminum pipe with 3 $\frac{1}{2}$ " aluminum cap, 30 inches in the ground, surrounded by stones. The cap is stamped as shown in the diagram.

From which:

A 5/8"x30" iron pin bears N45°E., 11.39 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.

A 5/8"x30" iron pin bears S27°E., 11.15 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.

A 5/8"x30" iron pin bears S47°W., 14.45 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.

A 5/8"x30" iron pin bears N43°W., 14.96 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.

I used a steel tape and magnetic compass, with 18°E. declination.

EVIDENCE FOUND: Found a 3 $\frac{1}{2}$ " aluminum cap set at ground level in a field. Also found a 1" iron pipe set approx. 8" N'y of corner. Corner lies East of a corner of fences running N-S-W, and SE of an abandoned homestead/building. Located all RP's as set by Watson. The SW and NW RP's are set in the fenceline running N-S. The SE and NE RP's are located in an open field.

DESCRIPTION OF MONUMENT AND ACCESSORIES SET:

Set a 3 ft. steel u-post alongside corner, with attached location tag.

FROM THE FOUND CORNER MONUMENT, I measure to Watson's 2005 RP's:

A 5/8" iron pin bears N.45°12'E., 11.38 ft., with attached red plastic cap mkd. CORNERSTONE SURVEYING INC.

A 5/8" iron pin bears S.26°57'E., 11.24 ft., with attached red plastic cap mkd. CORNERSTONE SURVEYING INC.

A 5/8" iron pin bears S.46°42'W., 14.44 ft., with attached red plastic cap mkd. CORNERSTONE SURVEYING INC.

A 5/8" iron pin bears N.43°06'W., 14.96 ft., with attached red plastic cap mkd. CORNERSTONE SURVEYING INC.

Used RTK GPS to measure RP's. Bearings to RP's are based on Geodetic North from a GPS observation taken at the corner point.


STATE PLANE COORDINATES (3601 ORN)

Reference Datum: NAD83(2011) from an OPUS Solution

Northing: 294,175.0 ft.

Easting: 8,465,542.3 ft.

Ellip. Ht: 2,350.1 ft.

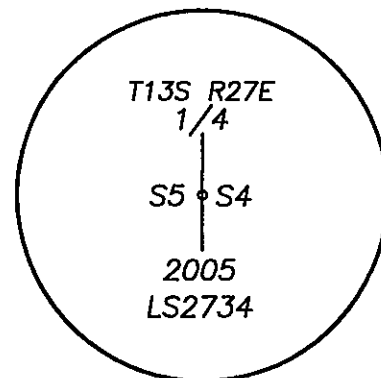

RESTORATION BY:


Michael C. Springer, PLS
Grant County Surveyor
Marcus Teague, Technician

217 N. Canyon Blvd.
John Day, OR, 97845
(541) 575-1251

Surveyed January 3, 2017

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

JAN 5 2017

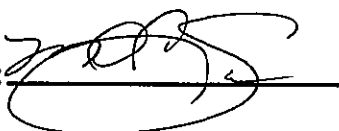BY: 

REGISTERED
PROFESSIONAL
LAND SURVEYOR


OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2018