


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Original corner established by: John B. David, Deputy Surveyor, under Contract No. 131, dated June 8, 1869.

Surveyor General Record States: Set stone 19x12x5 inches, for 1/4 section corner.

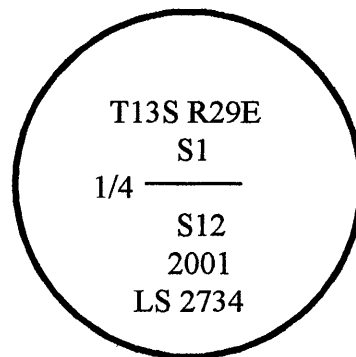

Description of corner evidence found:

No evidence of the original corner was found due to fencing in the area.

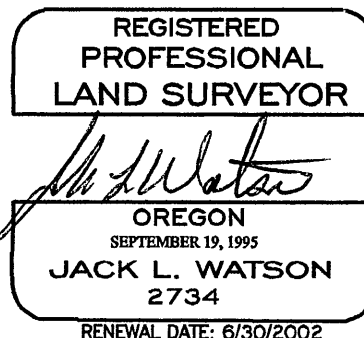

See Record Map of Survey No. 1607

Description of monument and accessories set at corner location:

At the position determined by proportion I set a 2½"x30" aluminum pipe with attached 3" aluminum cap, 18 inches in the ground, surrounded by a mound of stone. The cap is stamped as shown in the diagram.

From which:

- A 11" diam. Juniper bears N08°E, 76.2 feet, marked 1/4S1 BT.
- A 16" diam. Juniper bears N70°E, 79.0 feet, marked 1/4S1 BT.
- A 14" diam. Juniper bears S09°W, 72.1 feet, marked 1/4S12 BT.
- A 5/8"x30" iron pin bears N72°W, 32.3 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.

I used a magnetic compass, with 18° east variation, to center of BT's and steel tape measuring to a 50d nail driven in the side center at the root crown of the BT's. I used a magnetic compass, with 18° east variation and steel tape to tie references.

Date: July 24, 2001

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 6 day of Aug, 2001.
Robert D. Berger by _____
(COUNTY OFFICIAL) (DEPUTY)