


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T.13S., R.29E., INDEX L-03

History of original corner establishment:

This corner not previously established.

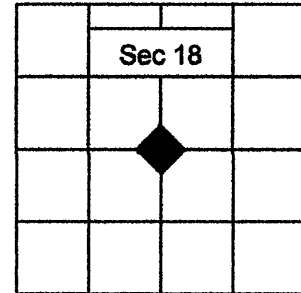

Description of corner evidence found:

Description of monument and accessories I establish to perpetuate the original location of this corner:

At the position determined by survey (See Grant County Survey No. ~~1710~~ ^{1711 RDB}), set a 2-1/2" x 30" aluminum pipe monument w/3" dia. cap stamped as shown in the DIAGRAM, 20" in the ground, raised a 3' dia. x 1' high mound stone from which:

A Juniper, 28" dia., bears N86°30'W, 97.5 ft., scribed "C1/4 S18 BT"

A Juniper, 18" dia., bears N75°00'E, 131.5 ft., scribed "C1/4 S18 BT"

A 5/8"x30" Rebar Pin bears N35°15'W, 12.5 ft.

A 5/8"x30" Rebar Pin bears S35°15'E, 14.8 ft.

Placed a yellow plastic cap marked "FSE SURVEY MARKER" on both pins.

DIAGRAM

T13S R29E
C1/4
-
S18
2004
PLS 49865

Measurements to accessories taken with a magnetic compass, declination 18° East, and distances measured with nylon clad steel tape.

I hereby certify that the above corner point was perpetuated as shown hereon on July 16, 2004

Witness: D. Mitchell Ferguson, LSIT
David H. Herburger, Surv. Tech.

Office of County Surveyor County of Grant
State of Oregon. I hereby certify that the within instrument was filed in this office
for record on the 2 day of Sept, 2004

Kenneth H. Delano Jr. by _____
County Surveyor Deputy



RENEWAL DATE:
01/01/2006