

RECEIVED AND
FILED

JUN 1 1978
John Liveira
JOHN LIVEIRA, County Clerk

CORNER RESTORATION


By _____ Deputy

CORNER N 1/4 TWP 13 S. RANGE 29 E.

ORIGINAL SURVEY BY: JOHN B. DAVID

CONTRACT NUMBER: 131

CONTRACT DATE: JUNE 8, 1869

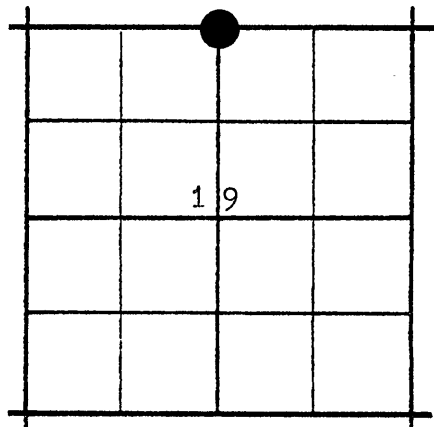

ORIGINAL DESCRIPTION:

N 89° 48' East on a true line between Secs. 18 & 19
41.25 Set Stone 17 x 12 x 5 for 1/4 Sec. Corner.

RESTORATION BY, STAMP AND DATE:

OREGON EAST ENGINEERING, INC.
PO BOX 277
MT. VERNON, OREGON

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Douglas M. Ferguson

OREGON
JULY 12, 1963
DOUGLAS M. FERGUSON
848

EVIDENCE FOUND:

FOUND STONE 15 x 10 x 5 WITH A VISIBLE 1/4 SCRIBE IN A SMALL MOUND OF STONES.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

SET A 2 1/2" x 30" GALV. IRON PIPE, WITH BRASS CAP, IN THE GROUND AND RAISED A MOUND OF STONE UP AROUND THE MONUMENT. BURIED ORIGINAL STONE ALONG EAST SIDE OF PIPE. FROM WHICH:

- A 10" JUNIPER BEARS N72°E - 21.6 FT.
SCRIBED T13SR29ES18 BT
- A 10" JUNIPER BEARS S17 1/2°W - 43.5 FT.
SCRIBED 1/4 S 19 BT
- COMPASS VARIATION 20°E.

Complete and File with Office of the Grant
County Surveyor, Grant County, Oregon,
Courthouse, Canyon City, Oregon 97820

MONUMENT MARKED

