


CORNER RESTORATION

N $\frac{1}{4}$ Cor.
CORNER Sec. 21 TWP 13 S. RANGE 29 E., W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

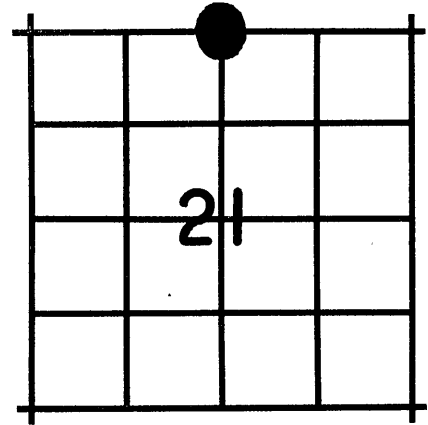

ORIGINAL DESCRIPTION:

Set stone 14x9x8 for 1/4 Section Corner.

Surveyors Record Book 1, Page 88:

July 1, 1914 - Vernon Glaze, County Surveyor, searched for this corner and did not find it. He established 1/4 corner common to sections 16 & 21 as follows: Set rock marked 1/4 CS erected mound of stone.

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
J. L. Watson
K. J. Workman

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

July 20, 1988

Grant County Surveyor

EVIDENCE FOUND:

Found Basalt Stone 19x10x10 inches, set by Vernon Glaze, County Surveyor, marked 1/4 CS on Southeast face, firmly set in ground.

I accept the position of this stone for the 1/4 corner.

See Record Map of Survey No. 1043.

RECEIVED AND
FILED

JUL 30 1988

OFFICE OF COUNTY SURVEYOR
Attest:

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the Corner Point: I set a 1 $\frac{1}{2}$ "x30" galvanized iron pipe 26 inches in the ground with Brass Cap marked as shown.

From which I set New Reference Points.

A 5/8"x30" iron pin with attached yellow plastic cap marked "BGA SURVEY MARKER", bears S. 46° W. 20.00 feet.

A 5/8"x30" iron pin with attached yellow plastic cap marked "BGA SURVEY MARKER", bears N. 45° W. 20.00 feet.

Buried cornerstone inverted, East and alongside iron pipe. Surrounded pipe with a mound of stone to top of cap.

Used magnetic compass with 20° E. variation and steel tape.

This corner is 42 feet North of a E-W fenceline.

MONUMENT MARKED

