


CORNER RESTORATION

N.E. Cor.
CORNER Sec. 21 TWP 13 S. RANGE 29 E., W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

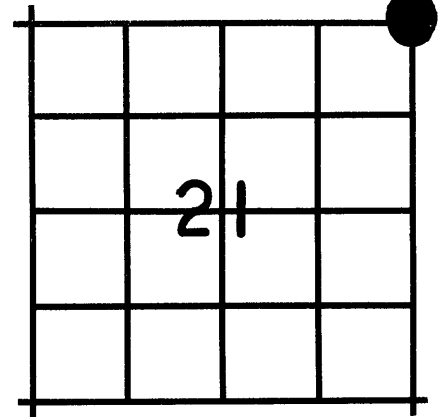

ORIGINAL DESCRIPTION:

Set stone 18x12x8 for corner to Secs. 15, 16, 21 and 22.

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
J. L. Watson
K. J. Workman

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

July 19, 1988

Grant County Surveyor

EVIDENCE FOUND:

Found original basalt corner stone 15x11x6 inches marked with 3 notches on one edge and 3 grooves on opposite face lying flat in depression in ground. I accept the position of this stone for the section corner. This corner is harmoniously related to other known corners in the area.

RECEIVED AND
FILED

JUL 30 1988

OFFICE OF COUNTY SURVEYOR
Robert D. Bagett
Attest:

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the Corner Point: I set a 1½"x30" galvanized iron pipe 24 inches in the ground with brass cap marked as shown. From which I set new reference points. **MONUMENT MARKED**

A 5/8"x30" iron pin with attached yellow plastic cap marked "BGA SURVEY MARKER", bears N. 45° E. 20.00 ft.

A 5/8"x30" iron pin with attached yellow plastic cap marked "BGA SURVEY MARKER", bears S. 47° E. 20.00 ft.


A 5/8"x30" iron pin with attached yellow plastic cap marked "BGA SURVEY MARKER", bears S. 45° W. 20.00 ft.

A 5/8"x30" iron pin with attached yellow plastic cap marked "BGA SURVEY MARKER" bears N. 47° W. 20.00 ft.

Buried cornerstone inverted, North and along side iron pipe, surrounded pipe with a mound of stone to top of cap.

Used magnetic compass with 20° E. variation and steel tape.

This corner is 68 feet North of a E-W fenceline and 45 feet West of a N-S fenceline,

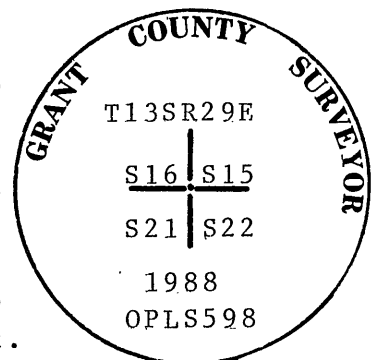

N-13