


CORNER RESTORATION

CORNER: C1/4 SEC. 24, TWP. 13 S., RANGE 29 E.

ORIGINAL SURVEY BY: Corner

CONTRACT NUMBER: Not Previously

CONTRACT DATE: Established

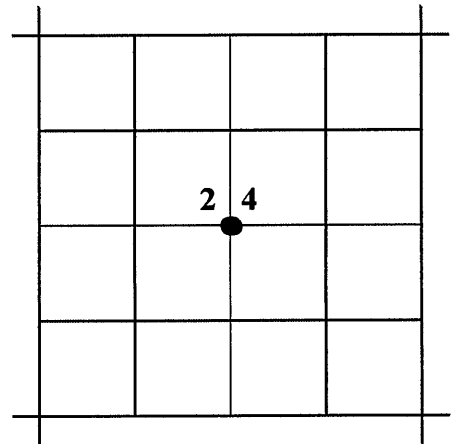

ORIGINAL DESCRIPTION: None

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
D.E. Mooney
M.C. Springer

RECEIVED AND
FILED

NOV. 28, 2001
OFFICE OF COUNTY SURVEYOR

Robert D. Bagett

ATTEST:

Michael C. Springer

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

Renewal Date 12/31/01

November 20, 2001

EVIDENCE FOUND: None

See Record Map of Survey No. 1616

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings including compass var.

At the corner point: I set a 5/8"x30" iron pin, 8" beneath the graveled surface of county road no. 46, with attached 1 1/2" alum. cap marked as shown.


From which I SET NEW REFERENCE POINTS:

A 5/8"x30" iron pin, bears N00°12'47"W, 32.2 ft.,
with attached alum. cap marked BGB SURVEY MARKER
RP 1 2001

A 5/8"x30" iron pin, bears S89°48'36"E, 31.9 ft.,
with attached alum. cap marked BGB SURVEY MARKER
RP 2 2001

A 5/8"x30" iron pin, bears S00°12'47"E, 51.1 ft.,
with attached alum. cap marked BGB SURVEY MARKER
RP 3 2001

A 5/8"x30" iron pin, bears N89°48'36"W, 59.8 ft.,
with attached alum. cap marked BGB SURVEY MARKER
RP 4 2001

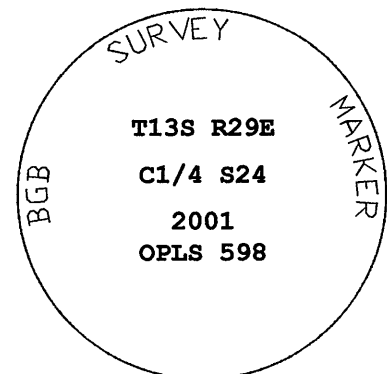

Used Leica SR530 RTK GPS receivers to measure reference points.