

FILED AND

APR 23 1974

JOHN LIVEIRA, County Clerk

CORNER RESTORATION


By Barbara Lemon Deputy

NE Cor.
CORNER Sec. 26 TWP 13S., RANGE 29E., W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

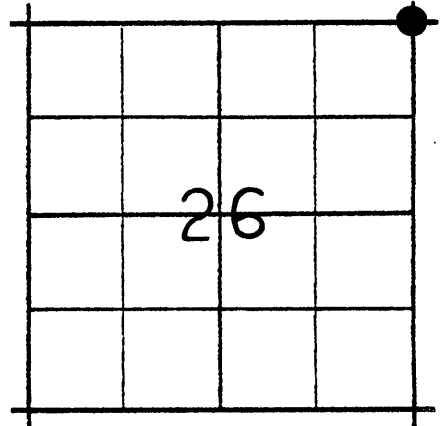

ORIGINAL DESCRIPTION:

80.00 Set stone 15x12x10 for corner to Secs. 23, 24, 25, & 26.

RESTORATION BY, STAMP AND DATE:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Baggett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

April 19, 1974

Grant County Surveyor

EVIDENCE FOUND:

Found a basalt stone, 16x14x11 inches, firmly set in a mound of stone, this stone is marked with 2 notches on one side and 1 notch on one edge. This corner was pointed out to me by Don Boyer, long time resident of the area. This corner is at the corner of fences running N-S-&E.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.


Set 1 1/2" x 30" iron pipe 22" in the ground with brass cap marked as shown.

I placed the original corner stone South and along side the iron pipe. MONUMENT MARKED

Surround the pipe with a mound of stone.

No bearing trees or bearing objects available.

Complete and File with Office of the Grant
County Surveyor, Grant County, Oregon,
Courthouse, Canyon City, Oregon 97820

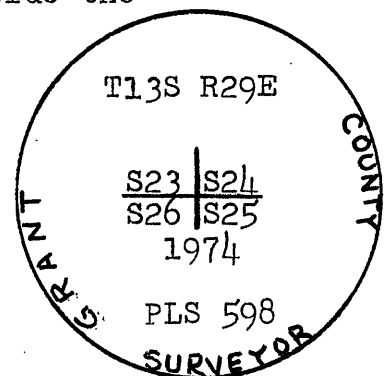

R-21