


CORNER RESTORATION

CORNER C1/4S24 TWP 13S RANGE R30E
 ORIGINAL SURVEY BY: Corner not established
 CONTRACT NUMBER: in the original survey
 CONTRACT DATE:

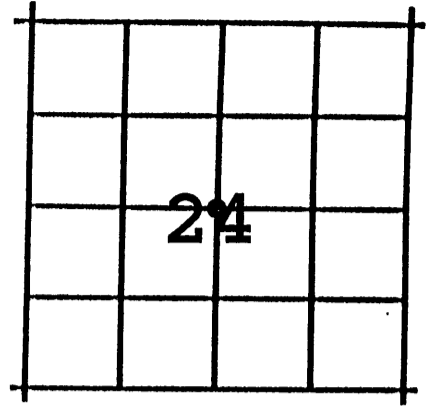

ORIGINAL DESCRIPTION:

None. Corner established this survey.

RESTORATION BY, STAMP AND DATE:

Set: 9-14-95

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 12, 1968
DOUGLAS M. FERGUSON
848

RECEIVED AND
FILED

DEC 5 1995

OFFICE OF COUNTY SURVEYOR
Attest: *[Signature]*

EVIDENCE FOUND:

None. Corner established this survey at intersection of N-S & E-W centerlines of the Section as shown on Grant County Map of Survey No. 1387.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:


Show how trees are scribed and basis of bearings, including compass var.

Set a 3" X 30" aluminum pipe with 3" aluminum cap stamped as shown in diagram, set 14" in the ground, and raised a 3 1/2' diameter X 2' high mound of stone around the monument.

MONUMENT MARKED

From Which:

- A Juniper 4" diameter bears N20° 51' W 47.1 ft
scribed C/4 S24 BT
- A Juniper 6" diameter bears N10° 17'E 42.5 ft.
scribed C1/4 S24 BT
- A Juniper 8" diameter bears S44° 45' W 22.1 ft.
Scribed C1/4 S24 BT
- A Juniper 8" diameter bears N85° 11' E 55.0 ft.
Scribed C1/4 S24 BT

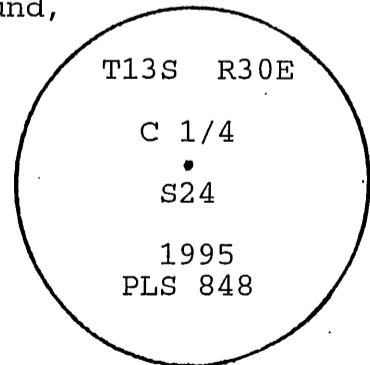

Measurements taken with an electric tachometer, with bearings based on Map of Survey #1387.