


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Original corner established by: John B. David , Deputy Surveyor, under Contract No. 331, dated June 8, 1869.

Surveyor General Record States: Set stone 16x9x7 for corner to sections 5,6,7 & 8.

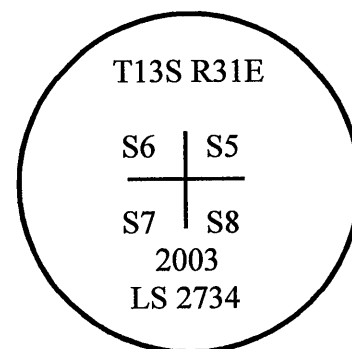

Description of corner evidence found:

No evidence of the original monument was found. I accept a fence corner running north, south and west as the best available evidence of the corner position.

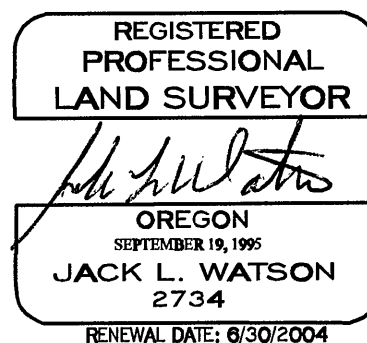

See Survey No. 1700

Description of monument and accessories set at corner location:

At the corner of fences running north, south and west, I set a 2½"x30" aluminum pipe with attached 3½" aluminum cap, 28 inches in the ground, surrounded by a ring of stone. The cap is stamped as shown in the diagram.

From which:

A 14"Juniper bears N70°E, 60.1 feet, marked T13SR31ES5BT

A 10"Juniper bears S31°E, 37.7 feet, marked T13SR31ES8BT

A 7"Juniper bears S56°W, 82.3 feet, marked T13SR31ES7BT

A 9"Juniper bears N08°W, 10.6 feet, marked T13SR31ES6BT

I used a steel tape measuring to a 50d nail driven in the side center at the root crown of the BT's and magnetic compass, with 18° E. declination.

Date: December 22, 2003

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 3 day of MAY, 2004.
Robert E. Bryant by _____
(COUNTY OFFICIAL) (DEPUTY)