


CORNER RESTORATION

CORNER: NE SEC. 16 TWP. 13 S. RANGE 31 E.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

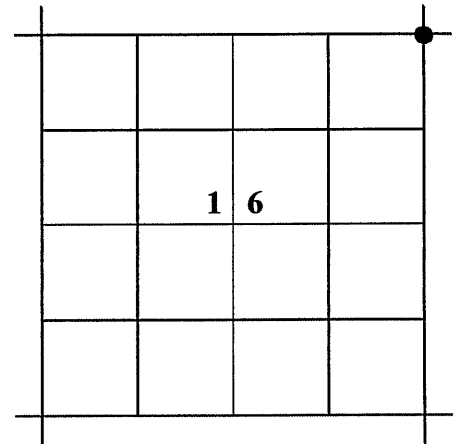

ORIGINAL DESCRIPTION: Set Stone 15x14x10 for corner to Secs. 9, 10, 15 & 16.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
J.L. Hatfield

RECEIVED AND
FILED

JUL 30, 2003
OFFICE OF COUNTY SURVEYOR
Robert D. Bagett

ATTEST: *Michael C. Spurgeon*

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

Renewal Date 12/31/03

See Record Map of Survey No. 1671.
July 18, 2003

EVIDENCE FOUND: After a diligent search, I found no evidence of the original marked stone. The corner of sections 9, 10, 15 and 16 is determined at the corner of barbed wire fences extending east and west, and an old down fence extending south. I accept this as the best available evidence of the position of the original corner.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings including compass var.

At the corner point: I set a 1½"x30" galv. iron pipe, 27" in the ground, with attached Bagett-Griffith and Blackman brass cap marked as shown.


From which I SCRIBE NEW BEARING TREES:

A Juniper, 13" diam., bears N11°E, 46.6 ft.
marked T13S R31E S10 BT

East stem of a double-stemmed Juniper, 20" diam.,
bears S34°E, 70.8 ft marked T13S R31E S15 BT

A Juniper, 20" diam., bears S85°W, 14.4 ft.
marked T13S R31E S16 BT

SW stem of a 3-stemmed Juniper, 8" diam., bears
N15°W, 34.5 ft marked S9 BT

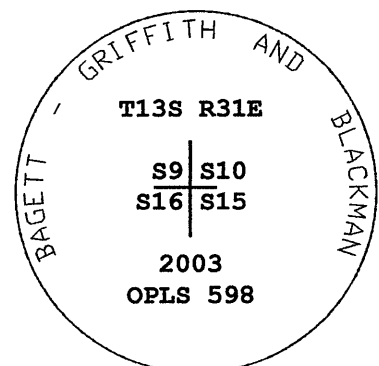

Raised a mound of stone 4 ft. base to 6" over top of cap. Used mag. compass with 17° var. and steel tape, measuring to a 50d nail driven in the side-center at the root crown of the BT's. Attached BT tags to BT's.