

RECEIVED AND
FILED

SEP 7 1973

CORNER RESTORATION

JOHN LIVEIRA, County Clerk


By Darlene Lemon Deputy

CORNER S. $\frac{1}{4}$ cor.
Sec. 21 TWP 13S., RANGE 31 E., W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

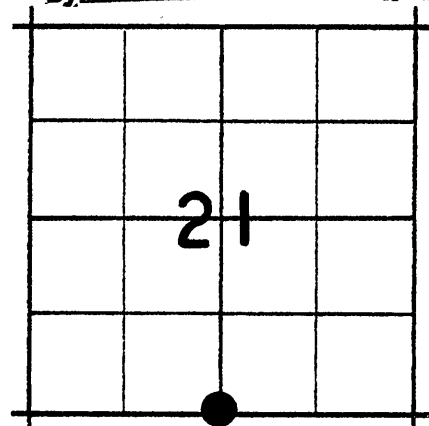

ORIGINAL DESCRIPTION:

S. $89^{\circ}51'W.$, on a true line between Secs. 21 and 28.

39.90 Set Stone 15x12x6 for $\frac{1}{4}$ sec. cor.

RESTORATION BY, STAMP AND DATE:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Baggett

OREGON
JULY 12, 1963
ROBERT D. BAGGETT
598

August 8, 1973

Grant County Surveyor

EVIDENCE FOUND:

Found a mound of stone and original $\frac{1}{4}$ cor. stone in fence weight nearby. The cor stone is a basalt stone 15x12x7 inches marked $\frac{1}{4}$.

It is evident that the stone came from the mound of stone, I therefore accept this position as the location of the $\frac{1}{4}$ corner. This position is harmoniously related to other known section corners in the vicinity.

Corner is about 8 feet East of a N-S wire fenceline.

SEE MAP OF SURVEY NO. 310.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set a $1\frac{1}{2}$ "x30" iron pipe 26" in the ground with brass cap marked as shown.

from which NEW BEARING TREES:

A 10" juniper bears N $23^{\circ}E.$, 41.6 ft., mkd. $\frac{1}{4}$ S21 CS BT.

A 10" juniper bears S $7^{\circ}E.$, 35.4 ft., mkd. $\frac{1}{4}$ S28 CS BT.

MONUMENT MARKED

I buried the original $\frac{1}{4}$ cor. stone SE and alongside the iron pipe, and raised a mound of stone to top of pipe.

I tagged both BTs with County Surveyor BT signs.


Used compass, $20^{\circ}E.$ var. & steel tape. Measured to

face of blaze on BTs.

Complete and File with Office of the Grant

County Surveyor, Grant County, Oregon,

Courthouse, Canyon City, Oregon 97820

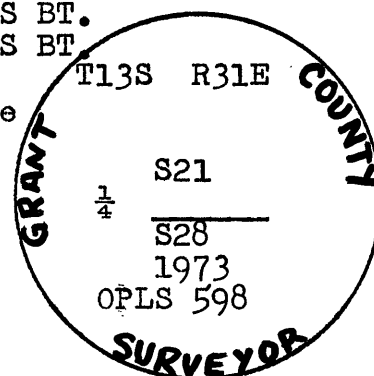

R-11