


CORNER RESTORATION

CORNER: N1/4 Cor. Sec. 26 Twp. 13 S., Rng. 31E., W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

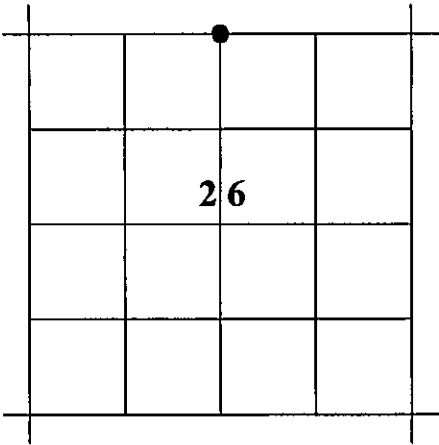

Subsequent Surveys:

- ▶ 1914 by Vernon Glaze during the platting of the City of John Day
- ▶ 1994 by Robert Bagett, Grant County Surveyor

ORIGINAL DESCRIPTION: Set stone 16x12x6 for 1/4 Sec. Corner.

- ▶ Glaze (in part): . . . marked by a piece of pipe 2½” diameter and 5 ft. long . . .
- ▶ Bagett (in part): . . . Found a 2½” diam axel set in concrete . . . set a ½”x3” brass stem, with 2½” diam. Grant County Surveyor brass cap. (shown below). Set monument box and lid over the monument . . .

RESTORATION BY, STAMP AND DATE:

Michael C. Springer, PLS
Jason Hatfield, PLS

RECEIVED AND
FILED

December 11, 2009
OFFICE OF COUNTY SURVEYOR

Michael C. Springer

ATTEST: *Jason Hatfield*

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Michael C. Springer


OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2010

December 1, 2009

Grant County Surveyor

EVIDENCE FOUND: Found a Grant County Surveyor brass cap in good condition in a monument box as described on Bagett’s Restoration Sheet from 1994. Found all the 1994 accessories in good condition. SEE 1994 RESTORATION SHEET FOR DETAILS ON THE MONUMENT AND REFERENCES.

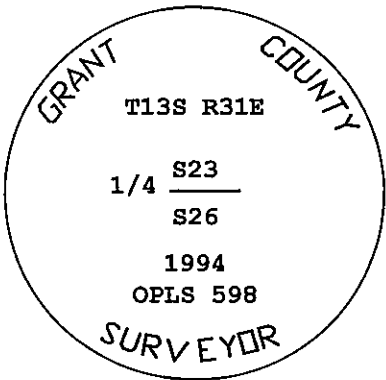

STATE PLANE COORDINATES: (3601 OR N) Reference Datum: NAD83

Northing: 277,743.58 ft.
Easting: 8,606,832.82 ft.
Ellip Ht: 3,015.3 ft.