

CORNER RESTORATION


CORNER: E1/4 Sec 25 TWP 13S. RANGE 31E.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

Subsequently remonumented by the Bureau of Land Management Aug-Sept 1971
See BLM field notes of Record Map of Survey No. 286

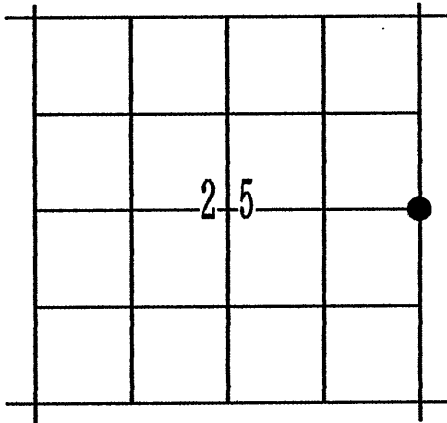

ORIGINAL DESCRIPTION: Set stone 16x8x7 for 1/4 Sec corner.

The BLM found the original stone in 1971. Their record states:

Set an iron post, 28 ins. long, 2½ ins. diam., 20 ins. in the ground, with brass cap mkd. (marks shown below)

from which

A juniper, 13 ins. diam., bears N.29°E., 221 lks. dist., mkd. ¼ S30 BT.
A juniper, 6 ins. diam., bears S.75¼°W., 23 lks. dist., mkd. ¼ S25 BT.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
G.J. Russell
S.D. Follweiler

RECEIVED AND
FILED
MAR 2, 1995
OFFICE OF COUNTY SURVEYOR

Robert D Bagett
ATTEST: Jeremy Russell

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D Bagett
OREGON
JULY 12, 1983
ROBERT D. BAGETT
598
Renewal Date 12/31/95

February 6, 1995

Grant County Surveyor

EVIDENCE FOUND: Found a 2½" galvanized iron pipe with attached 3" brass cap marked as shown below, set in a mound of stone.

From which:


A multi-trunk Juniper, the east trunk being 16"diam., bears N31°E, 145.8 ft. marked 1/4 S30 BT.
A Juniper 12"diam., bears S76°W, 15.2 ft. with partially healed over blaze, scibing visible.
Measured to the center of trees.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

MONUMENT MARKED

The monument set in 1971 is in good condition.

From which: I SCRIBE NEW BEARING TREES:
A Juniper 10"diam., bears S82°E, 61.1 ft. marked 1/4 S30 CSBT.
A Juniper 6"diam., bears N45°W, 67.9 ft. marked X CSBT.

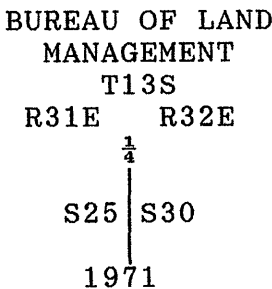

Repaired mound of stone 2 ft. base to top of cap. Used mag. compass with 20°E var. and a steel tape, measuring to a 50d nail driven in the sidecenter at the root crown of the BT's. Attached BT tags to BT's.