


CORNER RESTORATION

CORNER: SE1/16 SEC. 26 TWP. 13 S. RANGE 31 E.

ORIGINAL SURVEY BY: Harvey E. Wofford and
Lester E. Fischer, B.L.M.
Cadastral Surveyors

GROUP NUMBER: 741

DATE APPROVED: August 31, 1972

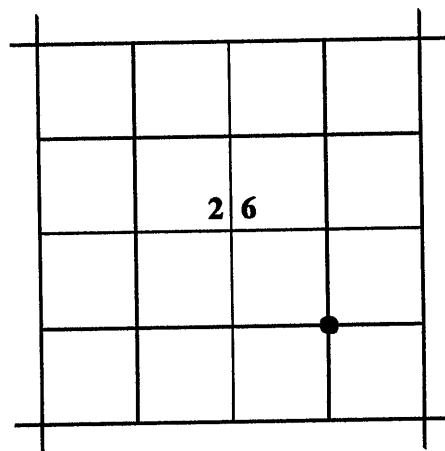

ORIGINAL DESCRIPTION: Set an iron post, 28 ins long, 2½ ins. diam., 24 ins. in the ground, with brass cap...

RESTORATION BY, STAMP AND DATE:

J.L. Hatfield, PLS
M.C. Springer, PLS

RECEIVED AND
FILED

April 16, 2009
OFFICE OF COUNTY SURVEYOR
M.C. Springer

ATTEST:

Jason L. Hatfield



April 8, 2009

EVIDENCE FOUND: The BLM brass cap described in the field notes bears S87°19'25"E, 59.41 feet from the true corner position. I do not accept this BLM monument.


See Record Survey No. 1862

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings including compass var.
At the corner point: I set a 5/8"x30" iron pin, 28" in the ground, with attached 2" diameter aluminum cap marked as shown.

From which I SCRIBE A NEW BEARING TREE:
A 16" diameter juniper bears N77°W, 26.6 ft.,
marked 1/16 S25 BT.

I also SET A NEW REFERENCE POINT:
A 5/8"x30" iron pin, bears N25°52'28"E, 36.57 ft.,
with attached alum. cap marked BMLS SURVEY MARKER
RP 1 2009.

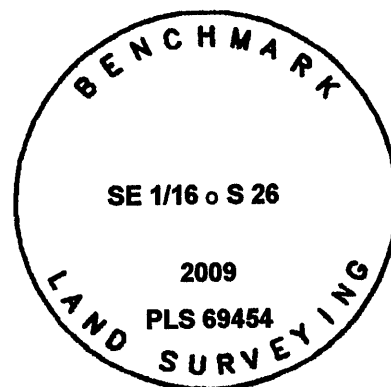

Used RTK GPS to measure the RP. Used a magnetic compass with 17° East variation and a steel tape to measure the BT, measuring to a 50d nail driven in the side-center at the root crown of the tree. Attached a BT tag to the tree.