


CORNER RESTORATION

CORNER: S1/16 SEC. 26 TWP. 13 S. RANGE 31 E.

ORIGINAL SURVEY BY: Harvey E. Wofford and
Lester E. Fischer, B.L.M.
Cadastral Surveyors

GROUP NUMBER: 741

DATE APPROVED: August 31, 1972

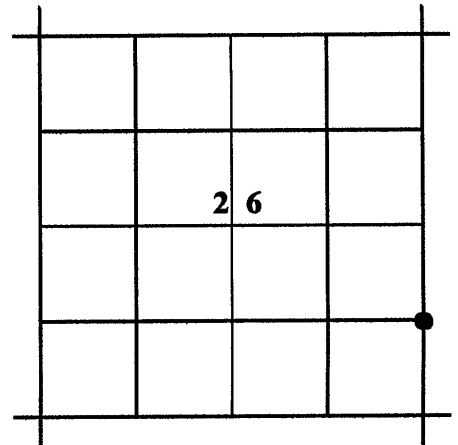

ORIGINAL DESCRIPTION: Set an iron post, 28 ins long, 2½ ins. diam., 24 ins. in the ground, with brass cap...

RESTORATION BY, STAMP AND DATE:

J.L. Hatfield, PLS
M.C. Springer, PLS

RECEIVED AND
FILED

April 16, 2009
OFFICE OF COUNTY SURVEYOR

ATTEST:

[Signature]
[Signature]



April 8, 2009

EVIDENCE FOUND: The BLM brass cap described in the field notes bears N67°31'03"E, 48.39 feet from the true corner position. I do not accept this BLM monument.

See Record Survey No. 1862


DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings including compass var.
At the corner point: I set a 5/8"x30" iron pin, 28" in the ground, with attached 2" diameter aluminum cap marked as shown.

From which I SCRIBE NEW BEARING TREES:

A 9" diameter juniper bears N55°42'E, 8.7 ft.,
marked 1/16 S25 BT.

A 7" diameter juniper bears S10°17'E, 22.0 ft.,
marked 1/16 S25 BT.

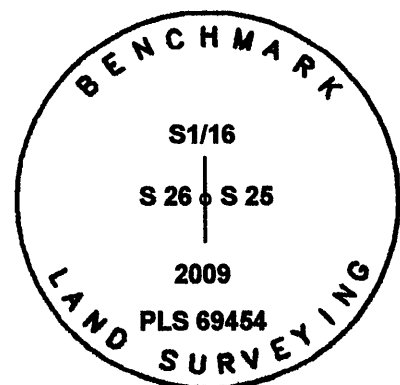

Used RTK GPS to measure bearings to the BT's. Used a steel tape to measure distances, measuring to a 50d nail driven in the side-center at the root crown of the trees. Attached a BT tags to the trees.