


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Original corner established by: John B. David, Deputy Surveyor, under Contract No. 131, dated June 8, 1869.

Surveyor General Record States: Set stone 18x11x9 inches, for corner to sections 25,26,35 and 36.

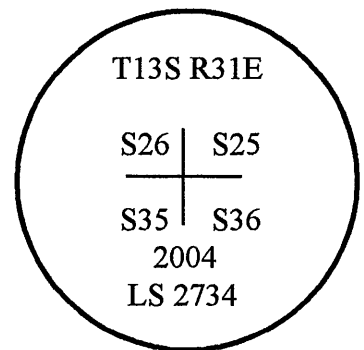

Description of corner evidence found:

No evidence of the original corner was found. A 2½ iron pipe with a BLM brass cap bears N76°47'48"E, 50.71 feet, I do not accept the monument for this corner position.

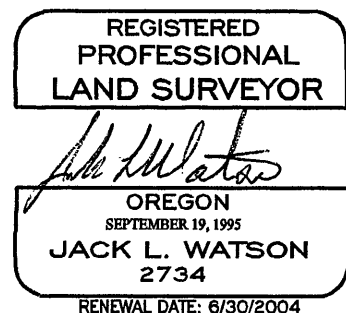

See Record Map of Survey No. 1690

Description of monument and accessories set at corner location:

At the point determined by double proportion, I set a 2½"x30" aluminum pipe with attached 3" aluminum cap, 24 inches in the ground, surrounded by a mound of stone. The cap is stamped as shown in the diagram.

From which:

A 8" juniper bears S79°E, 17.0 ft. marked T13SR31ES36BT.

A 5" juniper bears N58°W, 26.0 ft. marked XBT.

A 5/8"x30" iron pin bears N38°E, 11.00 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.

A 5/8"x30" iron pin bears S38°W, 10.07 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.

I used a steel tape measuring to a 50d nail driven in the side center at the root crown of the BT's and magnetic compass, with 18° E. declination.

Date: February 19, 2004

Office of SURVEYOR County of GRANT
State of OREGON, I hereby certify that the within instrument was filed in this office
for record on the 26 day of FEB, 2004.
Robert D. Beyer by _____
(COUNTY OFFICIAL) (DEPUTY)