

# CORNER RESTORATION


CORNER: SW Sec 33 TWP 13S. RANGE 31E.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

Subsequently resurveyed & monumented by  
Robert D. Bagett, County Surveyor,  
July 7, 1973, See corner restoration records.

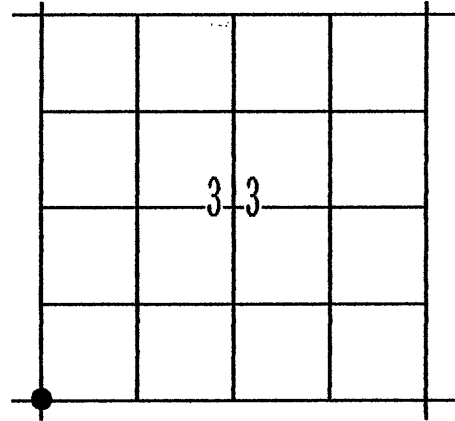

ORIGINAL DESCRIPTION: Set stone 17x9x5 for  $\frac{1}{4}$ sec. cor.

I did not find the original stone in 1973. My record states:

The original corner stone was not found. After a diligent search of the area and an extensive survey along the entire south boundary of the township and the south two tiers of sections, I decided on the following: I placed the corner at 22.50 chains west of the called creek and in a E-W fenceline which runs for miles along the township line. This puts the corner within a few feet of the record distance from the found corner to the north ( cor. common to secs. (28, 29, 32, & 33). This position is harmoniously related to other known corners in the area.

Set a  $1\frac{1}{2}$ "x30" iron pipe 18" in the ground, with a brass cap marked as shown. (marks shown below).

from which I scribe NEW BEARING TREES:

A 10" juniper bears N75°E., 26.6 feet, T13S R31E S33 CS BT.

A 12" Juniper bears N73°W., 145.2 feet, T13S R31E S32 CS BT.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett  
G.J. Russell  
S.D. Follweiler

RECEIVED AND  
FILED

MAR 2, 1995

OFFICE OF COUNTY SURVEYOR

*Robert D. Bagett*

ATTEST: *Jeremy Russell*

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Robert D. Bagett*

OREGON  
JULY 12, 1983  
ROBERT D. BAGETT  
598

Renewal Date 12/31/95

February 24, 1995

Grant County Surveyor

EVIDENCE FOUND: Found a  $1\frac{1}{2}$ " iron pipe with a  $2\frac{1}{2}$ " Grant County Surveyor brass cap marked as shown below, set in a mound of stone.

From which:

A multi-trunk Juniper, the west trunk being 18"diam., bears N78°E, 26.6 ft. to face of blaze, with partially healed over blaze, scibing visible.

A multi-trunk Juniper, the east trunk being 15"diam., bears N73°W, 145.2 ft. to face of blaze, with partially healed over blaze, scibing visible.

Corner is 1' south of corner of fences running North, East, and West.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

The monument set in 1973 is in good condition.

MONUMENT MARKED  
GRANT COUNTY  
SURVEYOR

From which: I SET NEW REFERENCE POINTS:

A  $\frac{5}{8}$ "x30" iron pin, bears S42°E, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 1 1995 OPLS 598.

T13S R31E  
S32 | S33

A  $\frac{5}{8}$ "x30" iron pin, bears S45°W, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 2 1995 OPLS 598.

S4  
T14S  
1973

Repaired mound of stone 3 ft. base to top of cap. Used mag. compass with 20°E var. and a steel tape.

OPLS 598