


CORNER RESTORATION

S $1/4$
CORNER Sec. 33 TWP 13S. RANGE 31 E. W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

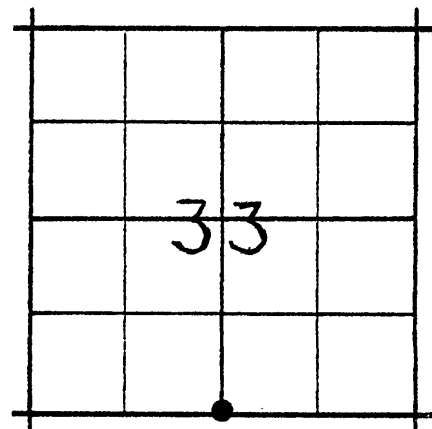

ORIGINAL DESCRIPTION:

S $89^{\circ} 57' W$ on a true line between Secs. 4 and 33.

Var. 23° East.

14.00 Creek $1/4$ lks. wide, runs North.

40.00 Set stone 17x9x5 for $1/4$ Sec corner.

RECEIVED AND
FILED

JAN 15 1974

JOHN LIVEIRA, County Clerk

By Deputy Deputy

RESTORATION BY, STAMP AND DATE:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

ROBERT D. BAGETT
JULY 12, 1963
598

December 6, 1973

Grant County Surveyor

EVIDENCE FOUND: SEE MAP OF SURVEY NO. 324.

The original $1/4$ stone was not found.

The position of the $1/4$ corner was established by means of single proportionate measure between the accepted corners, the SW. corner Sec. 33 $1/2$ mile West, and the SE. corner Sec. 34, $1\frac{1}{2}$ miles East.

This corner falls about 20 feet North of an E-W fence.

This position fits the record topography calls.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At point for $1/4$ corner: Set a $1\frac{1}{2}$ "x30" iron pipe 26 inches in the ground, with a brass cap marked as shown: MONUMENT MARKED
from which NEW BEARING TREES:


A juniper, 12 ins. diam., bears $S71^{\circ} W$, 81.25 feet,
scribed $\frac{1}{4}$ X CS BT.

A juniper, 15 ins. diam., bears $N31^{\circ} W$, 98.80 feet,
scribed $\frac{1}{4}$ S33 CS BT.

I surrounded the pipe with a mound of stone.

Used compass with 20° East var. and steel tape measuring to the face of the BTs.

Complete and File with Office of the Grant
County Surveyor, Grant County, Oregon,
Courthouse, Canyon City, Oregon 97820

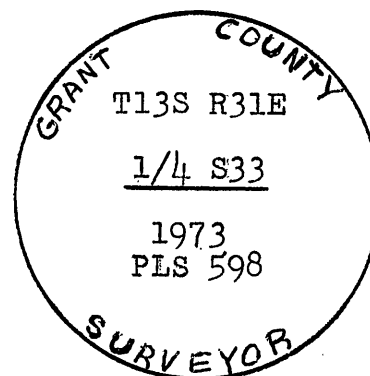

Z-11