


CORNER RESTORATION

^E $\frac{1}{4}$ Sec. cor.
CORNER Sec. 24 TWP 13S RANGE 32E

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

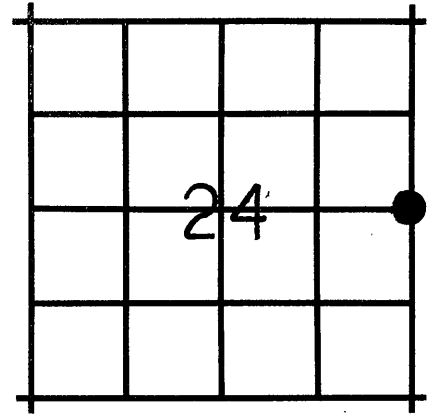

ORIGINAL DESCRIPTION:

South along West boundary of Sec. 19 (R33E)

40.00 set 14x12x12 stone for $\frac{1}{4}$ Sec. cor.

RESTORATION BY, STAMP AND DATE:

R. D. Baggett
S. F. Jackson
S. L. Crane

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Baggett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

March 13, 1978

Grant County Surveyor

EVIDENCE FOUND:

No evidence of the $\frac{1}{4}$ corner found.

I establish the $\frac{1}{4}$ corner at single proportionate measure on the range line between nearest found corners on the range line.

See Map of Survey No. 502.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.


At the corner point: Set a $1\frac{1}{2}$ "x30" iron pipe 26" in the ground with brass cap marked as shown.

MONUMENT MARKED

Surrounded pipe with mound of stone to top of cap.

No bearing trees available.

From monument a fence corner of fences running North-South-East, bears South 6 feet.

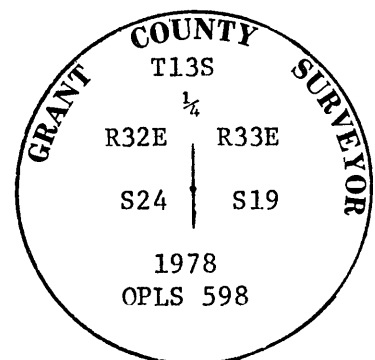

RECEIVED AND
FILED

APR 25 1978

JOHN LIVEIRA, County Clerk

By *Sammie Lawson* Deputy